

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

3

For corners in

REMONUMENTATION

Midland County	Located In:	Corner Code #
1. Public Land Survey	T 14N R 1W T 14N R 1W T R T R T R	A-4 ✓ A-5
2. Property Controlling in Section	S T R S T R	
3. Miscellaneous Property in Sec.	S T R S T R	
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

STATE OF MICHIGAN
MIDLAND COUNTY
REMONUMENTATION & FILED

30 NOV 93 3:06 P.M.

BEVERLY J THAYER
REGISTER OF DEEDS
Register of Deeds Stamp & File Number

I, Norman C. Caldwell in a field survey on May, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(A-4) 1/4 Cor. Sec. 7, T14N-R1W, and Sec. 12, T14N-R2W

Post placed by R. Clark, Jr. in 1830 orig. range line survey N28°W 34 L. (22.44') 16" B. Ash S13°W 11 L. (7.26') 7" B. Ash

Survey by P. Lapham, Recorded in Bk. 1 P. 465, Set 1/2" Capped rod, Midway & on Line: N45°W 21.9' 12" Oak; N10°W 12.8' 10" Oak; N60°E 14.4' 6" Oak; S30°E 6.4' 8" Ash.

(A-5) Sec. Cor. 7&18, T14N-R1W and 12&13, T14N-R2W

Wood post placed by R. Clark, Jr. in 1830 Orig. range line survey N26°W 22 L. (14.52') 12" Black Oak S47°W 12 L. (7.92') 10" Elm

Survey by P. Lapham, Recorded in Bk. 1 P. 314, Found Boat Spike: S45°E 68.59' P. Pole; S30°W 59.12' P. Pole; S20°W 78.18' Conc. Mon.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(A-4) 1/4 Cor. Sec. 7, T14N-R1W, and Sec. 12, T14N-R2W

Found 1/2" Iron Rod w/Cap per Bk. 1 P. 465.

(A-5) Sec. Cor. 7&18, T14N-R1W and 12&13, T14N-R2W

Found Boat Spike per Bk. 1 P. 314. Raised with 1/2" rod w/cap #12018.

A-4 & A-5 Approved by Midland County Peer Group October 27, 1993.

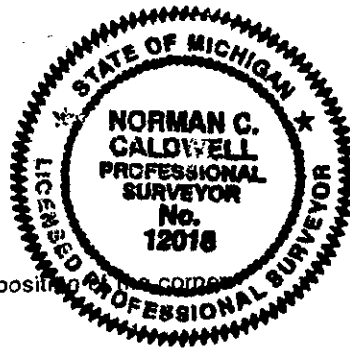

C. Description of monument for corner and accessories established to perpetuate locating the position of the original corner:

(A-4) 1/4 Cor. Sec. 7, T14N-R1W and Sec. 12, T14N-R2W

Found 1/2" iron rod w/cap per Book 1 Page 465 Lapham, and is accepted as the best available evidence of the position of the original corner.

N60°E 14.35' 6" Black Oak (R)
N22°W 12.78' 12" Black Oak (R)
N52°W 21.86' 14" Black Oak (R)
S02°E 30.99' 16" Twin Black Oak

(A-5) Sec. Cor. 7&18, T14N-R1W and 12&13, T14N-R2W

Found boat spike per Book 1, Page 314, Lapham, of surveys and is accepted as the best available evidence of the position of the original corner Raised with 1/2" re-rod w/cap #12018 and placed mon. box

S40°E 68.64' N&T in Power Pole (R)
S40°W 96.29' 10" Scotch Pine
N20°W 100.02' N&T in Power Pole
N05°E 94.95' N&T in fence post
North 37' +- C/L M-20

Signed by Norman C. Caldwell
Surveyor's Michigan License No. 12018

Date 24 NOV 93