

1993

9

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN  
MIDLAND COUNTY  
REMONUMENTATION & FILED

For corners in


Midland County

Located In: REMONUMENTATION  
Corner Code #

30 NOV 93 3:07 P.M.

BEVERLY J THAYER  
REGISTER OF DEEDS

- 1. Public Land Survey T 14N R 1W G-4, G-5
- 2. Property Controlling in Section S T R
- 3. Miscellaneous Property in Sec. S T
- 4. Lot No. , Recorded Plat
- 5. Private Claims

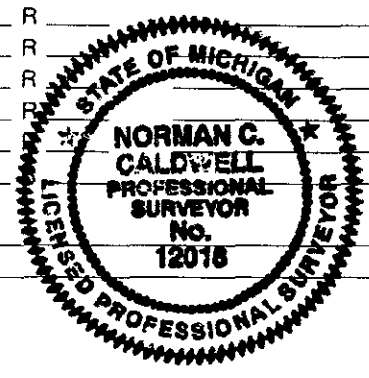

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Norman C. Caldwell, in a field survey on May, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- (G-4) 1/4 Cor, Sec. 9 & 10, T14N-R1W  
4" Maple Marked by Austin Burt in 1852 Subd. Resurvey  
N40°W 3 L.(1.98') 8" White Pine  
L.C.R.C. H. Fluharty, Recorded in Bk. 1 P. 424, Found Iron w/ 3/4" Bolt Type Head: N01°E 149.60' P. Pole; S10°W 147.81' P. Pole; N64°E 103.25' 8" W. Pine.  
Survey by Jerry Jones, L. 4, pg. 219
- (G-5) Sec. Cor. 9, 10, 15, & 16, T14N-R1W  
Post Placed by Austin Burt in 1852 Subd. Resurvey  
S24°W 7 L.(4.62') 7" White Oak  
N24°E 17 L.(11.22')8" White Pine  
Survey by H. Fluharty, Recorded in Bk. 1 P. 424, Found 3/4" Pipe in Mon. Box: S30°W 75.49' P. Pole; S18°W 109.27' P. Pole; N30°E 94.63' T. Pole.  
Monument also utilized in surveys of record in L. 1, pg. 557, pg. 558, & pg. 358, L. 3, pg. 73, L. 2, pg. 305, 847, & L. 4, pg. 63.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (G-4) 1/4 Cor, Sec. 9 & 10, T14N-R1W  
Found 3/4" Iron per Bk. 1 P. 424 & L. 4, pg. 219.
- (G-5) Sec. Cor. 9, 10, 15, & 16, T14N-R1W  
Found 3/4" Pipe in Mon Box per Bk. 1 P. 424. and surveys of record in L. 1, pg. 557, 558, pg. 358, L. 3, pg. 73, L. 2, pg. 305, 847 and L. 4, pg. 63.

G-4 & G-5 Approved by Midland County Peer Group October 27, 1993.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- (G-4) 1/4 Cor, Sec. 9 & 10, T14N-R1W  
Found 3/4" Iron per L.C.R.C. Bk. 1, P. 424 and survey in L. 4, pg. 219 and is accepted as the best available evidence of the position of the original corner.  
S09°W 147.90' Power Pole(R)  
N10°W 151.80' Power Pole  
N36°E 146.81' 14" White Pine  
N69°E 69.45' 6" Elm
- (G-5) Sec. Cor. 9, 10, 15 & 16, T14N-R1W  
Found 3/4" Pipe in Mon Box per Bk. 1 P. 424 and surveys of record in L. 1, pg. 557, 558, pg. 358, L. 3, pg. 73 L. 2, pg. 305, 847 & L. 4, pg. 63 and is accepted as the best available evidence of the position of the orig. cor.  
S15°E 109.31' Nail in Power Pole(R)  
S30°W 75.57' Power Pole (R)  
N25°E 94.50' Light Support Pole  
S40°E 145.01' N&T Power Pole  
North 31' CL pavement

Signed by Norman C. Caldwell  
Surveyor's Michigan License No. 12018

Date 29 NOV 93