

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A., 1970

For corners in
MONROE (58)
(County)

- 1. Public Land Survey
- 2. Property Controlling in Section
- 3. Miscellaneous Property in Sec.
- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

Located In: EXETER TWP.
T 5 S R 8 E
Corner Code # H-9

S _____ T _____ R _____
S _____ T _____ R _____
S _____ T _____ R _____
S _____ T _____ R _____

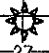
REGISTER OF DEEDS
 MONROE COUNTY, MICH.
George B. Warnke, Jr.

RECEIVED FOR RECORD
 99 DEC 28 AM 10:46

1999 G.B. Warnke Private Remonumentation Corner

I, George B. Warnke, Jr., in a field survey on August - November, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and / or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1819 - GLO - Joseph Fletcher - West / On the true line between Secs. No. 22 & 27 / 40.25' / Set the 1/4 sec. post at the average dis. from which a Lynn 8 ins. dia. bears S20W 20 lks. dis. & a B. Oak 10 ins. dia. bears S36E 19 lks. dis.
- 1974 - A.J. Marino - field notes - F. Stone - intersection of E. W. & No. FE. Lines
- 1990 - J.C. Andrus - Survey #90S-5783 - Existing monument stone
- 1994 - J.C. Andrus - Survey #94S-7109 - Found stone monument -
 N 26.00' to twin tree
 E 41.20' to twin tree
 S 7.11' to twin tree
 W 40.80' to twin tree

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner is located in field area with brush row to north, east & west & 500' south of South Stony Creek Road.
 8/16/1999 - Found stone 10" diameter & reset with set 1" x 36" pipe with set brass remonumentation disk & placed stones around pipe.
 Dug 3' x 2.5' hole with nothing further found & dug around stone 1' west with nothing further found. Witnesses from Andrus survey 94S-7109 checked. Brush rows to north, east & west & crop line to south.
 (cut down) East 41.20 feet to found nail with green plastic shiner in north face of twin tree

RATIFIED BY PEER GROUP, PA 345 OF 1990, MONROE COUNTY, MICHIGAN, DATE 11/2/1999, COUNTY REP. *[Signature]*

Corner is accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Set 1" x 36" pipe with set brass remonumentation cap & Witnesses:
- North 26.08 feet to found nail in west face of twin 18" dead Elm
- South 7.10 feet to found nail & shiner in west face of 8" Hawthorne
- West 40.74 feet to double head nail with remon. shiner in south face of 12" Hawthorne
- North 12.45 feet to double head nail & remon. shiner in west face of 12" Hawthorne
- North 75° East 31.20 feet to double head nail & remon. shiner in south face of 5" Wild Cherry

Signed by *[Signature]* Date November 19, 1999
 Surveyor's Michigan License No. 19474

