

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A., 1970

For corners in
MONROE (58)
(County)

Located In: Corner Code #

DUNDEE TWP.

T6S R6E

K-6

- 1. Public Land Survey
2. Property Controlling in Section
3. Miscellaneous Property in Sec.
4. Lot No. Recorded Plat
5. Private Claims

REGISTER OF DEEDS
MONROE COUNTY, MICH

RECEIVED FOR RECORD
99 OCT 14 AM 9:28

1998 & 1999 Remonumentation Program Corner

Register of Deeds Stamp & File Number

I, George B. Warnke, Jr. in a field survey on 9/4/1998 & 9/9/1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and / or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1819 - GLO - North Between Secs. 13 & 14 / 40.00 Set qr. Sec. Post
1914 - J.W. White - Survey - notes S.W. cor. NW1/4 Sec. 13
6/45 - Detroit Edison - witness card - fd 1/2" iron rod - witnesses:
N29°W 38.71' MBT pole
S88°E 32.50' 4" Thornapple
S25°E 39.41' 8" Walnut
? - Michigan State Highway Department - 1/4 cor is 17' W. of S.
1973 - G.B. Warnke - Survey #73-13-A & 73-13-B & 73-13-C - recorded in Liber 657, Page 689 & Liber 647, Page 690 & Liber 674, Page 689 - I.P in Mon box - witnesses: West 17.0 from ctr. Joint south bound lane US 23 @ Sta 1005+68.28
1982 - G.B. Warnke - Survey #82-109 - I. Pin in monument box
1983 - G.B. Warnke - Survey #83-352 - iron in mon. box - witnesses: East 17' to CL joint S. Bound US 23 @ Sta. 1005+68.28
1984 - G.B. Warnke - Survey #84-250 - recorded in Book 923, Page 440 - Fd. Monument Box
1986 - G.B. Warnke - Survey #84-250-2&3 - Iron in monument box
1990 - G.B. Warnke - Survey #84-250-4&5 - Fd monument box - located from previous survey now under conc. shoulder
1990 - Arvin Butterfield - LCRC recorded in Liber 0003, Page 0086 (& Survey #901570 recorded in Liber 1113, Page 0860) - corner destroyed due to new highway construction - set 3/4" pipe over 1/2" rod in conc. shoulder of S.B. U.S. 23 - witnesses: nail w/ tag in top of north end guard rail post S12°W 41.35' nail w/ tag in top of guard rail post N85°W 71.88'
*+ in sta: 1005+00 S05°E 65.93'
*+ in sta: 1006+00 N10°E 35.62'
C/L joint in S.B. U.S. 23 East 17.19'

Grid table with columns A-L and rows 1-13. Cell (6,14) contains a circled '13'.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

9/4/98 - G.B. Warnke found 3/4" pipe & cap #21561 & checked 3 witnesses with other 2 appearing to be in place but not checked due to traffic. 9/9/99 - set / glued plastic remonumentation cap on / over existing pipe & set carsonite post near corner.

RATIFIED BY PEER GROUP, PA 345 OF 1990, MONROE COUNTY, MICHIGAN, DATE 9/8/1998, COUNTY REP.


Corner is accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set / glued plastic remonumentation cap on / over found 3/4" pipe in concrete shoulder of southbound U.S. 23 & Witnesses: West 10.00 feet to 1" x 18" iron rod set as witness South 45° West 23.72 feet to red GPS cap #39086 which is 18.2 feet west of edge of pavement West 8 feet to remonumentation carsonite post North 15° West 54.7 feet to southwest corner of east post for Exit 17 sign East 5.2 feet to west edge of concrete pavement of southbound lane

Signed by [Signature]
Surveyor's Michigan License No. 19474

Date September 10, 1999

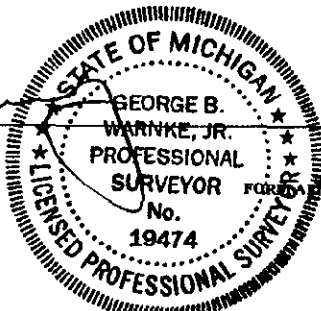

APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1994