

# SURVEY & REMONUMENTATION

FEB 13 1998

## SECTION

For corners in

Monroe (58)

(County)

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A., 1970

Located In:

Corner Code #

**WHITEFORD TWP.**

T8S R6E

C-3

T R

T R

T R

S T R

S T R

S T R

S T R

1. Public Land Survey

2. Property Controlling in Section

3. Miscellaneous Property in Sec.

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

### 1997 Remonumentation Corner

I, George B. Warnke, Jr., in a field survey on October 22, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and / or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

- 1820 GLO, Joseph Wampler, set post corner of Secs. 5, 6, 7 & 8 from which a Sugar 9 ins. dia. bears N74W 15 lks. dis. & a Sugar 5 ins. dia. bears N40E 24 lks. dis.
- 1953 A.J. Marino notes - F. stone - P. iron
- 1965 Michigan State Highway Department, Jesse M. Carlson - found 1/2" pipe 1/2' below surface of road at the intersection of Stone Quarry and Samaria Roads
- 1969 Glenn Richard - Found I.P. & witnessed
- 1972? G.B. Warnke witness card - Found Iron Pin
- 1977 Byron Brady survey, Liber 740, Page 486 - Iron stake
- 1979 A.J. Marino notes - F.I.P.
- 1995 David Andrus LCRC, Liber 4, Page 31 - Found 1/2" Pipe
- 1997 John Blanchard, David Arthur Consultants, survey - Fnd. 1/2" iron pin

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

In 10/1997, G.B. Warnke - found 3/4" x 18" I pipe 0.2 deep and 1/2" x 18" iron at 18" deep at an angle and found 0.5 x 0.5 sq. stone at 22" deep and 22" long chiseled lime stone. No other evidence found. Set 1" x 36" pipe in monument box to replace found stone.


RATIFIED BY PEER GROUP, PA 345 OF 1990, MONROE COUNTY, MICHIGAN, DATE 11/18/1997, COUNTY REC. 

12/1/1997, G.B. Warnke set brass remonumentation cap on previously set 1" x 36" pipe in monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 1" x 36" pipe with brass remonumentation cap in monument box to replace found irons over stone and is accepted as the best available evidence of the position of the original corner. Witnesses:  
 South 45° West 38.68' PK in northwest face of utility pole  
 South 35° East 51.22' to tag bolt & washer in blaze in westerly face of 24" Ash  
 North 50° West 18.30' to southeast corner of northwest head wall  
 North 50° East 16.34 feet to southwest corner of northeast headwall  
 North 45° West 38.64' to PK nail in southeast face of utility pole

Signed by

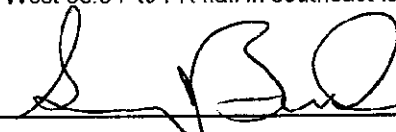

Surveyor's Michigan License No.

19474



Date December 3, 1997

RECEIVED FOR RECORD  
 97 DEC 30 PM 3:15  
 Register of Deeds  
 Monroe County, Mich.  
*George B. Warnke, Jr.*

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3			●										
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													