

JAN 20 2000


SECTION

MONTCALM COUNTY REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Montcalm
(County)

Located In:
Bloomer Township

Corner Code #

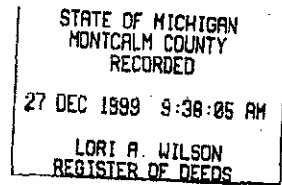

Register of Deeds Stamp & File Number

- 1. Public Land Survey T 09 N R 05 W M-13
T _____ R _____
T _____ R _____
T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
Property in Sec. S _____ T _____ R _____
- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, William G. Tingley, in a field survey on November 4, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
March 7, 1831 Robert Clark Jr. DS. Intersected west boundary at end of 5. 75. 86.
Witnesses: Sugar 14" S11°W, 14 links; Beech 10" N21°E, 38 links.
December 14-17, 1869. D.W. Attenburg, DS. Post corner 2 X 2 - stones - and stones on corner. No witnesses given
April 10, 1902 Charles Eddy, County Surveyor, Commencing at the NW corner of said section found stone for corner witnessed by:
Apple 1 1/2" S11°E 69 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Found PK nail as filed in LCRC, Liber 2, page 16, Gratiot County Records by Thomas Mueller, PS. Dug through 6" of asphalt and found stake and pointed stone set in cairn of stones. Accepted pointed stone in cairn of stones as a careful and faithful reestablishment of the position of the original corner.

Placed 1/2" rod to point of stone and set Clinton County Monument and Monument box*

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
SW Corner, Section 6

- *Set Standard Clinton County Monument and monument box.
- Nail and tag #13039 in NE side Power Pole S73°E 139.91 feet
- Nail and tag #13039 in SW side Telephone pole N40°W 47.70 feet
- Nail and tag #13039 in NW side Power pole S69°W 67.00 feet
- Nail and tag #13039 in NW side Power pole S47°W 40.70 feet

* Standard Clinton County Monument is a 2 1/2" dia. Steel tube 30" long with a stamped brass cap and breakaway magnetic base.

Signed by: William Tingley Date: May 28 1997

Surveyor's Michigan License No. 30104

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1976
REVISED JAN., 1982
ADAPTED FOR WORD PROCESSING MARCH, 1992

ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD May 28, 1997

WGT
William Tingley, PS, Chairman

