

**MONTCALM COUNTY REMONUMENTATION PROGRAM**  
**LAND CORNER RECORDATION CERTIFICATE**  
 Filing Requirement of Act 74, Mich. P.A. 1970

**DEC 19 2000**


**SECTION**

For corners in  
Montcalm  
 (County)

Located In:  
 Eureka Township

Corner Code #

- |                                    |        |             |                         |
|------------------------------------|--------|-------------|-------------------------|
| 1. Public Land Survey              | Sec 18 | T 09N R 08W | <u>A-06</u> W-1/4       |
|                                    |        | T 09 R 09   | <u>M-06</u> <u>KENT</u> |
|                                    |        | T R         |                         |
|                                    |        | T R         |                         |
| 2. Property Controlling in Section | S      | T R         |                         |
|                                    | S      | T R         |                         |
| 3. Miscellaneous Property in Sec.  | S      | T R         |                         |
|                                    | S      | T R         |                         |

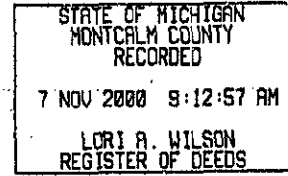

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, William Tingley a field surveyor on May 8, 2000 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

- May 28, 1837, Noah Brookfield, Deputy Surveyor, GLO Notes  
 Set Post  
 White Oak 12" S21°W 91 links (60.06 feet)  
 White Oak 12" N29°W 93 links (61.38 feet)
- May, 1963, Michigan State Highway Department  
 Found 3/4" Iron Pipe in Center of Road  
 Twin Elm 9" N37°W 57.76 feet  
 Elm 36" N75°E 108.24 feet  
 Telephone Pole S47°E 53.73 feet  
 Northeast corner Section 13 = North, 2642.13 feet
- November 1972, R.J. Crater, #16924, Liber 468, Page 760, recorded survey  
 Found Iron  
 Power Pole S45°E 86.60 feet  
 Twin Hickory 5" S40°E 45.90 feet  
 Cherry 16" N55°E 35.90 feet
- November 1972, R.J. Crater, #16924, Liber 1, Page 63, recorded LCRC  
 Found 3/4" Pipe, Set 9/16" Rod beside it  
 Elm (dead) 9" N37°W 57.76 feet  
 Found M.S.H.D. Tag in Elm Stump N75°E 108.29 feet  
 Power Pole S45°E 86.60 feet  
 Twin Hickory 5" S40°E 45.90 feet  
 Cherry 16" N55°E 35.90 feet

ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 10/11/00

WGT  
 William Tingley, PS, Chairman



Continued on back

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
 Searched the apparent location of the corner. Found Kent Co. Harrison monument.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 Kent Co. Mon.  
 Fnd N/T E/S P.P. S40°W 86.51 feet  
 Fnd N/T S/S 13" Oak N40°W 45.01 feet  
 Fnd N/T N/S P.P. S75°E 258.22 feet  
 Fnd N/T S/S 11" Poplar N82°E 95.90 feet



LIBER 4 PAGE 293

This corner is accepted as the best available evidence of the position of the original corner. Bearings given are magnetic.

Signed by William Tingley Date 10/11/00  
 Surveyor's Michigan License No. 30104



5. 1984, W. Byl, #23502, LCRC 3944, Kent County Records

Found 3/4" Iron pipe in Centerline of N-S gravel road 5 feet North of Centerline of gravel road to East.

Found 1958-63 bearing tree from Williams & Works notes (10" cherry, NW, 35.35 feet). Now 18"

Stump, Northwest, 35 feet approximate to face. Found 12" Stump, N40°W, 58 feet approximately. 1958-1963

Williams & Works note also records Northeast Corner Section 13, North 2642.80 feet and fence post West 28.5 feet.

Northeast Corner Section 13	North	2642.87 feet
Southeast Corner Section 13	South	2647.0 feet
Fence Post (down)	West	29.0 feet approximately

Set Kent County Monument in place of 3/4" Iron Pipe.

Nail and Tag Eastside Power Pole	S40°W	86.51 feet
Nail and Tag Northside 18" Cherry Stump	N55°W	35.95 feet
Nail and Tag Southside 10" Oak	N40°W	45.01 feet
Nail and Tag Northside Power Pole	S75°E	258.22 feet

DEC 19 2000

6. 1994, J. Glaza, #40166, LCRC 7259, Kent County Records

Same data as LCRC 3944 except no Cherry Stump and

Nail and Tag in Southside 6" Poplar	N82°E	95.90 feet
-------------------------------------	-------	------------

SECTION

7. September 20, 1999, Randy Kolehouse # 25854, Kent County Remon LCRC # 11669

Found Standard Kent County Monument on the C/L of Montcalm Avenue (gravel) running north and south per LCRC's # 3944 and # 7259 as set by William Byl in place of a 3/4" iron pipe which checked with the 1963 records of MDSH&T and the 1958-63 notes of Williams & Works.

Nail/KC remon tag E/S PP	S38°W	86.41 feet
Nail/KC remon tag SW/S oak 11"	N44°W	44.90 feet
Nail/KC remon tag N/S PP	S77°E	258.11 feet
Nail/KC remon tag S/S cherry 8"	N75°E	95.59 feet
Nail/KC remon tag S/S walnut 8"	N88°E	191.66 feet
On C/L of gravel N-S road		

Faint text and markings at the bottom of the page, including a circular stamp.