

**SURVEY &
REMONUMENTATION**

MAY 07 1997

MONTCALM COUNTY REMONUMENTATION PROGRAM

LAND CORNER RECORDATION CERTIFICATE

COMMISSION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Montcalm (County) Located In: Ferris/Richland Townships Corner Code # _____

1. Public Land Survey Sec 1 T 11N R 5W M-1 NE Corner
 T 12N R 5W M-13 SE Corner
 T _____ R _____
 T _____ R _____

2. Property Controlling S _____ T _____ R _____
 in Section S _____ T _____ R _____

3. Miscellaneous S _____ T _____ R _____
 Property in Sec. S _____ T _____ R _____

STATE OF MICHIGAN
MONTCALM COUNTY
RECORDED

11/14/1996 4:09:18 PM

VIRGINIA L. KNEPPER
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____
 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, William Tingley a field survey on July 26, 1994 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 1831, Roger Clarke, Jr., Deputy Surveyor, GLO Notes

- Set Post
 Beech 10" N45°E 28 links
 Elm 17" S24°W 8 links
 May 1879, S.S. Hastings, County Surveyor, Liber C, Page 29
 Cedar Post set deep with stones around it
 November 1978, Jerry L. Jones, #19838, recorded survey, Liber 417, Page 624
 Found Mon Box 3/4" Pipe
 Southeast to Road Sign 33.35 feet
 Southwest to Road Sign 38.65 feet
 North to Centerline 14" Twin Oak 44.7 feet
 November 1978, Jerry L. Jones #19838, LCRC, Liber 1, Page 444
 Same as above.
 November 1987, Thomas J. Mueller, #25861, recorded survey, Liber 479, Page 1245
 Found Mon Box

ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 7/27/94


WST
 William Tingley, PS, Chairman

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 Found 3/4" Iron Pipe in Mon Box 1 foot long, set in 1-1/2" iron pipe, found large stone under pipe 2.5 feet deep
 On Westside of Pipe 2.2 feet deep with small stones and broken glass
 Corner is common townships 11 and 12 North, 4 and 5 West

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Set Remonumentation Corner set over Pipes on East side Large Stone
 Found Nail and Tag 26" Twin Maple S30°W 73.92 feet
 Found Nail and Tag Cedar Post S50°E 42.38 feet
 Found 14" Twin Oak (now stump) North 44.83 feet
 Northeast corner brick pillar 1' square S70°W 139.77 feet

This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

Signed by William Tingley Date 7-29-94
 Surveyor's Michigan License No. 30104

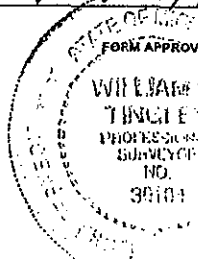

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 26, 11
 REVISED MAY 14, 11
 REVISED JAN., 11
 ADAPTED FOR WORD PROCESSING MARCH, 11