

JAN 17 1996

COMMISSION

MONTCALM COUNTY REMONUMENTATION PROGRAM

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in <u>Montcalm</u> (County)	Located in: <u>Richland Township</u>	Corner Code # <u>C-6, 1/4</u>
1. Public Land Survey	Sec 17 T <u>12</u> N R <u>5W</u>	<u>C-6, 1/4</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

STATE OF MICHIGAN
MONTCALM COUNTY
RECORDED

20 DEC 95 11:41 A.M.

VIRGINIA L. KNEPPER
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, William Tingley a field surveyor on April 19, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
1838, Enoch Hammell, Deputy Surveyor, GLO Notes

Set 1/4 Section Post

Pine 26" N62°W 3 links
Pine 22" N22°E 10 links

1907, John Daoust, County Surveyor

Found gas pipe agreeing with new bearing tree.

Took new Bearing Tree: Pine Stump 20" East 94-1/4 links

R.D. McNutt's Index Cards

H.M. Caukin, 1895, Pine Stump 22" S30°W 42 links

Also Daoust 1907 record

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Found 3/4" x 1.4 feet iron pipe over a 1-1/2" x 1.6 feet gas pipe (2.2 feet deep). At intersection of extensions of road centerlines from West and North. Also on tree row to South.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Set remonumentation monument over 1-1/2" gas pipe.

Set Nail and Tag in Westside Wood Post N45°E 19.58 feet
Set Nail and Tag in Southwest Power Pole S45°E 43.07 feet
Found Nail and Tag in Wood Post S10°W 33.88 feet
Southerly Leg Road Sign West 31.80 feet

This corner is accepted as a careful and faithful perpetuation of the position of the original corner

ACCEPTED BY THE MONTCALM COUNTY SURVEY PER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 12.5.95

WGT
William Tingley, PS, Chairman

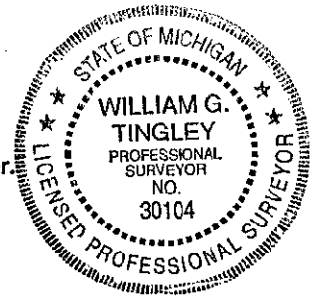

Signed by William G. Tingley Date 12-12 1995
Surveyor's Michigan License No. 30104

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 25, 1971
REVISED MAY 14, 1976
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1983