

SEP 19 1999

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
COUNTY OF MUSKEGON
RECEIVED FOR RECORD

1998 DEC 23 AM 8:11

SECTION

For corners in

MUSKEGON (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>9N</u> R <u>14W</u>	<u>J-9</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling In Section	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____

Carrie Carter
REGISTER OF DEEDS

LIBER 2187 PAGE 890

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, STANLEY H. SHACKELFORD, in a field survey on JUNE 18, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A: Description of original monument and accessories and/or subsequent restoration:

1837 G.L.O. set post.
N 10° E 13.20' 20" Beech
S 06° W 8.58' 40" Hemlock


1950 ERA M.C.R.C. Tie Book, found 1"x2" iron bar raised with 1" pipe.
SW 43.90' 6" Maple
NE 65.75' 6" Elm
NW 65.70 16" Maple
SW 43.43' 10" White Cherry

1973 Liber 1014, page 410, recorded by Russell Roon. Found 3/4" pipe.
NW 25.40' 10" Maple
N 15.75' 6" Maple
SE 42.37' 26" Beech

June 2 1998
POSITION OF SAID
RECORDED CORNER
REVIEWED & RATIFIED
BY MUSKEGON COUNTY
PEER GROUP IN ACCORDANCE
WITH P.A. 345, OF 1990

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-9 Found 1"x15" pipe over 1"x2" flat stock in broken porcelain. Removed and set 2 3/4"x31" cast-iron monument.
S 67° E 43.85' 12" Maple Found Nail N Side
S 06° W 19.71' 8" Ash Found Nail E Side
S 70° W 74.85' 16" Maple Set Nail NW Side
N 49° W 25.19' 10"-14" Twin Maple Found Nail E Side
N 11° W 16.38' 12" Maple Set Nail West Side
S 63° E 63.81' 16" Ash Set Nail N Side
Accepted position of corner due to historical usage and documentation.

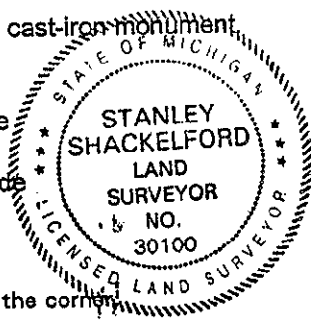

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-9 Set 2 3/4"x31" cast-iron county survey monument.
S 67° E 43.85' 12" Maple Found Nail N Side
S 06° W 19.71' 8" Ash Found Nail E Side
S 70° W 74.85' 16" Maple Set Nail NW Side
N 49° W 25.19' 10"-14" Twin Maple Found Nail E Side
N 11° W 16.38' 12" Maple Set Nail W Side
S 63° E 63.81' 16" Ash Set Nail N Side

Signed by Stanley H. Shackelford
Surveyor's Michigan License No. 30100

Date 12-22-98

A 1965