

FEB 09 2000

LIBER 2326 PAGE 795

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

STATE OF MICHIGAN
COUNTY OF MUSKEGON
RECEIVED FOR RECORD

1999 DEC 27 PM 12: 46

Mark Fairchild
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

For corners in

SECTION

<u>Muskegon</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>9N</u> R <u>14W</u>	<u>K-4</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling In Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

I, Stephen V. Vallier, in a field survey on December, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

- 1837 G.L.O. (John Mullett) set the quarter section post.
8" Sugar for corner
- 1868 Village of Ravenna plat by E. Egelston.
- 1967 W. Works of Consumers Power Company found an iron.
S 9.2' Stump
N 28.15' Stump
N 62.40' 12" Twin Oak
- 1984 C. F. Lewandowski, corner obliterated, and reset with a 4"x30" cast-iron monument with a county surveyor's cap, using the center of section and the North 1/8 corner of the Southeast 1/4, as per several previous surveys. Recorded L.C.R.C. in Liber 1301, Page 609.
N 5° E 62.96' Twin Oak
S 30° W 186.30' Power Pole
East 13'± C/L of Gravel Road
- 1985 C. F. Lewandowski added clarifying language relevant to the method of re-setting the West 1/4 post of Section 12, T9N, R14W, as recorded in Liber 1301, Page 609. (Corner Obliterated) Reset corner using the center of section 11, T9N, R14W, and the north 1/8 corner of the Southeast 1/4 of said Section 11, T9N, R14W (same witnesses as in Liber 1301, Page 609.)

**MARK F. FAIRCHILD
MUSKEGON COUNTY
Register of Deeds
Recorded Copy!**

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found a 4" cast-iron monument 1.5' deep on the north/south occupation line.
N 5° E 62.96' 20" Twin Oak Found nail on west side
S 30° W 186.30' Power Pole Found nail on east side
East 13'± C/L of Gravel Dr.

POSITION OF SAID
RECORDED CORNER
REVIEWED & RATIFIED
BY THE REGISTER OF DEEDS
MUSKEGON COUNTY
IN ACCORDANCE
WITH ACT 5, OF 1996

Evidence is inconclusive as to the perpetuation of the original G.L.O. corner position.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found a 4" cast-iron monument with county surveyor's cap on the north/south occupation line. Corner is approximately 1.5' deep.
N 5° E 62.96' 20" Twin Oak Found nail on west side
S 30° W 186.30' Power Pole Found nail on east side
East 13'± C/L of Gravel Dr.

507
8/10/99

Signed by *Stephen V. Vallier*
Surveyor's Michigan License No. 28428

Date 12/27/99
No. 28428
FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995

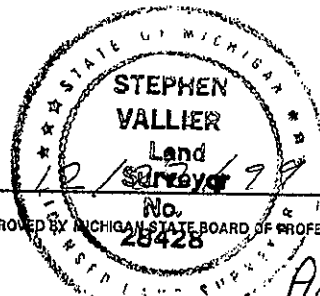

A2084