

APR 04 1996

**COMMISSION**

**LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

**Muskegon**

(County)

Located In:

Corner Code #

1. Public Land Survey	T	11N	R	16W	C-13
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S		T		R
	S		T		R
3. Miscellaneous Property in Sec.	S		T		R
	S		T		R

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

STATE OF MICHIGAN  
 COUNTY OF MUSKEGON  
 REGISTER OF DEEDS  
 1995 DEC 18 PM 4:12  
 Register of Deeds Stamp & File Number

I, Stephen V. Vallier, P.S. in a field survey on November 9, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

1836 GLO set corner	N 11 deg. E	25 Links	10" Pine
	N 58 deg. W	30 Links	10" White Oak
1949 M. Buck survey distance	2660.40' Southwest	corner to West 1/4 corner	Section 32.
1950's MCRC 1/2" Iron	NW	65.88'	30" Oak
	SE	74.10'	Power Pole
	NW	50.48'	10" Oak
	SE	39.28'	12" Oak
	ENE	85.72'	Power Pole

(see Exhibit "A")

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" x 18" Iron Rod along side 1" x 26" Iron Pipe in Monument Box

N 46 deg. W	65.57'	48" Oak
S 36 deg. E	73.96'	Power Pole

Accepted position of corner due to historical usage and documentation.


POSITION OF SAID  
RECORDED CORNER  
REVIEWED & RATIFIED  
BY MUSKEGON COUNTY  
PEER GROUP IN ACCORDANCE  
WITH P.A. 345, OF 1990

*Aug. 1, 1995 SVV*

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 2 3/4" x 30" Cast Iron Monument with County Survey Cap in Monument Box. Replaced 1/2" x 18" Iron Rod.

N 06 deg. E	26.66'	Telephone Pole (found PK nail W side)
N 73 deg. E	85.67'	Power Pole (found nail N side)
N 46 deg. W	65.57'	48" Oak (set nail Southerly side)
S 51 deg. E	84.19'	24" Oak (set nail Southerly side)
S 36 deg. E	73.96'	Power Pole (found nail E side)
S 50 deg. W	43.54'	20" Maple (set nail E side)

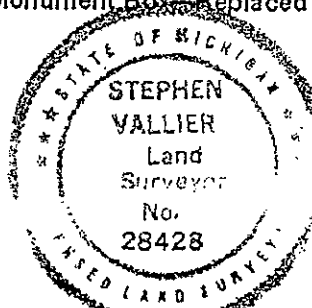

Signed by *Stephen Vallier*

Date 12/15/95

Surveyor's Michigan License No. 28428