


STATE OF MICHIGAN
DEPARTMENT
OF
NATURAL RESOURCES

LAND CORNER RECORD

Marquette COUNTY
T 45N R 30W

DESCRIPTION OF CORNER 1/4 corner between Sections 22 and 27
CORNER MONUMENT No monument, as the corner is on the cabin front porch, but point
witnessed as shown below:
DATE MONUMENT PLACED AND WITNESSED February 8, 1972
WITNESSES TO CORNER..... SW'yly corner of cabin foundation S81°W (true) 12.33 ft.

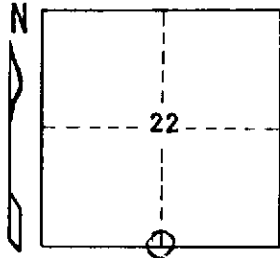

SE'yly corner of cabin foundation N50°E (true) 18.63 ft.
Variation 4°10' West at this corner. Cabin is easternmost of
2 cabins.
Ref.- Lands Division, MDNR, Lansing, Mich.
AND Transcript No. 6881, G.L.O., 1929: "Field Notes
of the Survey of an Island in 'Long Lake' in
Sec. 16 and an Island in 'Island Lake' in
Sec. 27, T45N, R30W."

CIRCLE CORNER REGISTERED

DESCRIPTION IN DETAIL AS TO HOW CORNER WAS LOCATED AND IDENTIFIED OR RESTORED.

This corner was perpetuated in Sept. 1929 with a 2"x36" iron pipe with brass cap, in the course of a survey of an island in Island Lake by the General Land Office. Corner identified by reference to the original BT's. The monument was subsequently destroyed and a cabin constructed over the corner, the corner lying under the front porch. The G.L.O. notes show measurements from similar monuments at SW section corner and at an aux. M.C. on the N. shore of an island in Island Lake, these measurements being N89°47'W 39.96 ch. and S21°47'E 6.00 ch., respectively. Point for corner recovered by means of these measurements, from the existing monuments.

SURVEYOR'S SEAL

DISTRIBUTION:

SIGNED

Arthur O. Enger
REGISTERED LAND SURVEYOR

DATE July 17, 1972

Arthur O. Enger

County Courthouse
Area Forester (Regions I & II)
District or Region Surveyor
Forestry Div., Lansing

R 4047
Rev. 10/68