SURVEY & REMONUMENTATION

MAR 1 3 1998

MARQUETTE COUNTY MICHIGAN RECEIVED FOR RECORD

SECTION LAND CORNER RECORDATION CERTIFICATE

1997 DEC 26 PM 12: 46

	Filing Require	<i>C</i> 1 .	
For corners in MARQUETTE (County)	_ Located In:	Corner Code #	Patricis d.: REGISTER OF
1. Public Land Survey	T <u>46N</u> R <u>25W</u> T R	<u>H-9</u>	

Patricia	a. Mary	lem
REGISTER	OF DEEDS	Ju

	1 H		
	TR		
	TR		
2. Property Controlling	S T R		
in Section	S T R		
3. Miscellaneous	S		
Property in Sec.	S R		
4. Lot No, Re 5. Private Claims	corded Plat	· · · · · · · · · · · · · · · · · · ·	_
5. Frivate Claims			_

LIBER	R	Register of Deeds Stamp & File Number										
	A L	В	c	D	E	F	G	н	I I	J	к	L

, in a field survey on JUNE. 12TH GERALD W. CARLSON do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the comer points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the comer points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Description of original monument and accessories and/or subsequent restoration: H-9: Quarter Corner common to Sections 22 and 27.

1845: William Ives' original subdivision survey notes describe the corner monument as a wood post referenced by:

Spruce Pine S26E. 05 L

Spruce Pine


N64W, 06 L

1945: Survey field notes from M.C.R.C. F.B. #697, Pg. 63, indicate the corner as a set Iron Pipe and Jack Pine Post referenced by:

J. Pine

S21W, 23.9 10" J. Pine

N72W, 27.3'

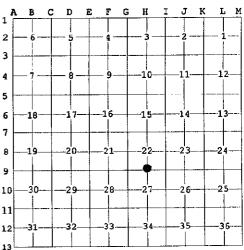

RATIFIED BY PEER GROUP P.A. 345 OF 1990

No Date: The M.C.R.C. Government Corner Index Book (F.B. #647 - Sec. 22) indicates the corner as an Iron Pipe and Jack Pine Post referenced by:

9" J. Pine

S21W.

23.91

10" J. Pine

N72W, 27.3'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-9: 1997: No original corner evidence found. Found and accepted a 1/2" I.D. X 36" Pipe, 1.2' above ground, with old paint and flagging. Also found 2 witness trees as described in Part C below. Checked Line Call: Did not measure distance (West, 5.63 chains [371.58'], 4" Spruce Pine) as entire area has been altered by man (logged) since the original survey. Distance West is 2663.81' and distance East is 2682.78'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-9: 1997: Replaced found pipe with a 2 3/8" O.D. aluminum pipe capped with a 3 1/4" diameter aluminum tablet Marquette County Survey Monument stamped to identify the corner. Monument is 0.1' above ground. Measured existing references:

S21W,

24.21(to C/L); 24.04' (to set d.h. nail) (MCRC NBT) 27.52' (to d.h. nail at C/L) (MCRC NBT)

15" J. Pîne 16" J. Pine N72W,

Established new references:

24589

7" J. Pine N87E. 22.36

49.90' 14" J. Pine N01W. Orange Steel Sign Post w/ Yellow Survey Marker Sign

S75€,

1.47' Note: Bearing trees have painted face, butt, and side nail blazes, d.h. measuring nails, and stamped B.T. Tags affixed.

TE OF MICH GERALD W **CARLSON** SURVEYOR No. 24589

Guald Worlson

Surveyor's Michigan License No._

_ Date 12-18-97