

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	(MARQUETTE COUNTY) LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 46 <sup>N.</sup> R. 29 <sup>W.</sup>	#M-10
2. PROPERTY CONTROLLING IN SECTION	25, T. 46 <sup>N.</sup> R. 29 <sup>W.</sup>	#7
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ R. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:  
**Corner M-10 (1/4 corner between Sections 25 & 30, T46N, R28-29W):**  
 Cedar post (Not found. No subsequent monuments found.)  
 Cedar 7 S28E 4 (Not found. No subsequent accessories found.)  
 Cedar 8 N33W 18 (Not found. No subsequent accessories found.)

**Corner 7 (North 1/16 corner between Sections 25 & 30, T46N, R28-29W):**  
 Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:  
**Corner M-10:** Restored 10-10-79 proportionately on line between Sec. Cor. 40.069 ch. S and original 1/4 cor. 240.416 ch. N.  
**Corner 7:** Established 10-31-79 on line between 1/4 cor. 20.035 ch. S and Sec. Cor. 20.035 ch. N.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
**Corner M-10:** 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.  
 Tamarack 12 N61°E (mag.) 13.0 ft. "1/4S, NBT"  
 Tamarack 13 N34°W (mag.) 24.4 ft. "1/4S, NBT"  
 Declination 1° 25' West.  
**Corner 7:** 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.  
 Red Pine 14 N76°E (mag.) 9.4 ft. "1/16S, BT"  
 Red Pine 14 S11°E (mag.) 23.2 ft. "1/16S, BT"  
 Declination 1° 25' West.

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_


(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Arthur O. Enger DATE March 7, 1980

MICHIGAN REGISTERED LAND SURVEYOR  
 Arthur O. Enger

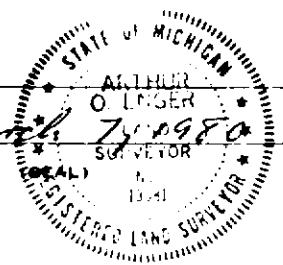

Michigan Department of Natural Resources

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581