

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

(MARQUETTE COUNTY)

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY.....	T. 46 N. R. 29 X. W.	#1-9
2. PROPERTY CONTROLLING IN SECTION 26	T. 46 N. R. 29 X. W.	#3
3. MISCELLANEOUS PROPERTY IN SECTION.....	T. S. R. E. W.	
4. LOT NO. ...., RECORDED PLAT.....		
5. PRIVATE CLAIMS.....		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

**Corner I-9 (Section Corner 22, 23, 26 & 27, T46N, R29W):**

- Maple post (Not found. No subsequent monuments found.)
- Y. Pine 18 S67W 42 (Probably found. No subsequent accessories found.)
- W. Birch 6 N50E 33 (Not found. No subsequent accessories found.)

**Corner 3 (North 1/16 corner between Sections 26 & 27, T46N, R29W):**

Not established in original survey nor subsequently, apparently.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

**Corner I-9:** On 10-03-79, restored corner from remains of a down and rotted white pine corresponding in size with the record original. Corner position checks with a Y. Pine stump found N0°20'W 12.648 ch.; the record calling for a Y. Pine line tree 12.62 ch. N of the corner. Also checks with a W. Pine stump found S0°43'W 10.21 ch.; the record calling for a W. Pine line tree 10.27 ch. S of the corner. Also checks with a Y. Pine line tree and original sec. cor. to E.

**Corner 3:** Established 11-8-79 on line between 1/4 cor. 20.062 ch. S and Sec. Cor. 20.062 ch. N.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

**Corner I-9:** 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.  
 Jack Pine 14 N72°W (mag.) 25.0 ft. "S22, NBT"  
 Jack Pine 7 N41-1/2°E (mag.) 80.6 ft. "S23, NBT"  
 Red Pine 4 S59°E (mag.) 81.7 ft. "S26, NBT"  
 Declination 1° 05' West.

**Corner 3:** 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.  
 Jack Pine 6 S38°E (mag.) 35.2 ft. "1/16S, BT"  
 Jack Pine 3 N33°E (mag.) 59.6 ft. "1/16S, BT"  
 Declination 1° 25' West.

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

(SEAL)


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Arthur O. Enger DATE March 7, 1980

CHIEF OF SURVEY PARTY  
 MICHIGAN REGISTERED LAND SURVEYOR  
 Arthur O. Enger

Michigan Department of Natural Resources

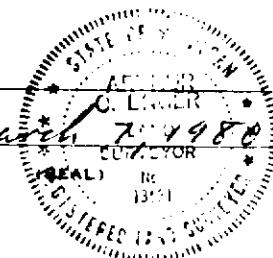

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581