

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	(MARQUETTE COUNTY) LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY.....	T. 46 N. X. R. 29 X. W.	#M-6
2. PROPERTY CONTROLLING IN SECTION 13	T. 46 N. X. R. 29 X. W.	#7
3. MISCELLANEOUS PROPERTY IN SECTION.....	T. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner M-6 (1/4 corner between Sections 13 & 18, T46N, R28-29W):
 Spruce 4 for corner (Not found. No subsequent monuments found.)
 Spruce 4 N58E 29 (Not found. No subsequent accessories found.)
 Spruce 4 N78W 14 (Not found. No subsequent accessories found.)

Corner 7 (North 1/16 corner between Sections 13 & 18, T46N, R28-29W):
 Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner M-6: Restored 10-8-79 proportionately on line between Sec. Cor. 200.347 ch. S and an original 1/4 cor. 80.139 ch. N. Corner is in spruce thicket in spruce-tamarack swamp.

Corner 7: Established 10-18-79 on line between Sec. Cor. 20.035 ch. N and 1/4 cor. 20.035 ch. S. Corner is in a large open spruce-tamarack bog swamp.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner M-6: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
 Tamarack 5 S36°E (mag.) 11.4 ft. "1/4S, NBT"
 Tamarack 6 N10°E (mag.) 11.4 ft. "1/4S, NBT"
 Declination 2° 25' West.

Corner 7: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
 Tamarack 3 N43°W (mag.) 29.6 ft. "1/16S, BT"
 Tamarack 5 N22°E (mag.) 45.0 ft. "1/16S, BT"
 Declination 2° 10' West.

SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

(SEAL)


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE March 7, 1980

CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger
 Michigan Department of Natural Resources

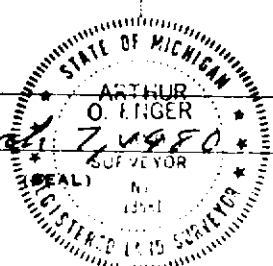

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581