

1998 DEC 29 PM 3:22

SECTION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

*Patricia A. Manley*  
REGISTER OF DEEDS

For corners in MARQUETTE Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_  
(County)

1. Public Land Survey T 47N R 25W \_\_\_\_\_ K-2  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_

2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

LIBER **R 2** PAGE **117**  
Register of Deeds Stamp & File Number

I, GERALD W. CARLSON, in a field survey on SEPTEMBER 10<sup>th</sup>, 19 98, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

1	A	B	C	D	E	F	G	H	I	J	K	L
2		6		5		4		3		2		1
3												
4		7		8		9		10		11		12
5												
6		18		17		16		15		14		13
7												
8		19		20		21		22		23		24
9												
10		30		29		28		27		26		25
11												
12		31		32		33		34		35		36
13												

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:  
K-2: Quarter Corner common to Sections 1 and 2.

1845: A.D. Sullivan's original subdivision survey notes describe the corner monument as a wood post referenced by:  
12" Birch S51E, 16 L 8" Birch S88W, 07 L

1977: An LCRC recorded by Gerald W. Carlson P.S. #24589 in L. 1, RC Pg. 329, indicates he set a 5/8" X 18" Iron and cap by single proportionate measurement between the SW and NW corners of Section 1 on South side of steep rock cliffs. Corner is +/- 66' South of Summit of granite outcrop called for in original GLO notes. Referenced by:  
15" W. Pine N07W, 20.99 18" R. Pine N82W, 25.06'  
8" W. Birch Cluster S19E, 8.57' 24" W. Pine N63E, 18.20'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-2: 1998: No original corner evidence found. Found and accepted the 5/8" x 18" Iron and cap referenced in Part "A" above. Checked line calls South, 11.00 chains to summit of hill, (726'-R, 750-M), North, 1.00 chains to summit of knob, (66-R, 62'-M). Distance North is 2602.42' and distance South is 2592.75'.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-2: 1998: Set a 3 1/4" diameter aluminum tablet Marquette County Survey Monument stamped to identify the corner on a 26" x 3/4" rebar drilled and grouted into solid rock.. Monument is 1.1' above ground. Existing references:

14" W. Pine N06W, 21.52' (Carlson NBT) 18" R. Pine N75W, 24.94' (Carlson NBT)  
17" W. Pine N62E, 18.34' (Carlson NBT)

Established new references:


4" W. Pine S68W, 14.16'

Sign Post w/ Yellow Survey Marker Sign on 14" R. Pine, N40W, 26.5'.

Note: Bearing trees have painted face, butt, and side nail blazes, d.h. measuring nails, and stamped B.T. Tags affixed.

RATIFIED BY PEER GROUP  
P.A. 245 OF 1990

*Gerald W. Carlson*  
DATE 12/21/98

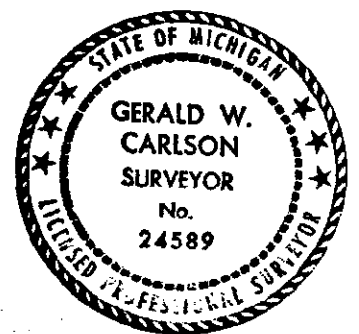

Signed by Gerald W. Carlson

Date 12-29-98

Surveyor's Michigan License No. 24589