

SURVEY & REMONUMENTATION

JAN 09 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Approved by Menominee County
Land Survey Remonumentation
Peer Group Under Act 345 of
P.A. of 1990 On 12/22, 2000
McC Davis BLS
Chairman

For corners in


MENOMINEE
(County)

Located In:

Corner Code #

- | | | |
|------------------------------------|---|-------------|
| 1. Public Land Survey | T <u>33NR</u> <u>26W</u> | <u>C-4</u> |
| | T <u> </u> <u> </u> | <u> </u> |
| | T <u> </u> <u> </u> | <u> </u> |
| | T <u> </u> <u> </u> | <u> </u> |
| 2. Property Controlling in Section | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| 3. Miscellaneous Property in Sec. | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |

Bk. 6 Pg. 205

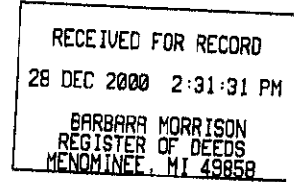

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

I, William Lenca, in a field survey on Nov., 1900 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1848: Original Survey by James H. Mullett - B.T.'s - Cedar, 18" - N34°W - 13 lks.; Cedar, 12" - N23°E - 9 lks. NW OBT still evident.
- 1990: L.C.R.C. No. 887, Book 3, by Gerald L. Wiggins, RLS No. 23521 states set DNR monument at very old squared stake in old north and south fence line. A cedar stump with lower notch and blaze, (no scribe marks visible), fits original, a cedar 18", N34°W, 13 lks. Interior fences and farmed area fit this location. This position makes the north 1/2 mile 2643.82' and the south 1/2 mile 2918.89'. TIES: 5" B. Ash, N15°E, 34.4' & 8" B. Ash, S82°E, 35.05' & 5" Maple, S46°W, 67.5' & 8" Spruce, N79°W, 76.85'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We found 1 inch diameter iron pipe with a 4 inch diameter aluminum cap (DNR monument) and 4 B.T.'s in place as described in L.C.R.C. No. 887 (see part A). Since the position of the old squared stake was verified by remnants of an original B.T., we accepted the corner as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Accepted Existing 1" dia. Iron Pipe/4" Alum. Cap stamped for corner location.

6" dia. Black Ash (Existing BT)	N15°E	34.65 feet	Scr. NBT
9" dia. Black Ash (Existing BT)	S82°E	35.33 feet	Scr. NBT
5" dia. White Ash	S13°E	38.06 feet	Scr. NBT
10" dia. Black Ash	N73°W	44.05 feet	Scr. NBT
Metal Survey Sign Post	North	1.0 feet	

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca
Surveyor's Michigan License No. 26461

Date Dec. 13, 2000



205