

SURVEY & REMONUMENTATION

FEB 11 1998

Approved by Menominee County
Land Survey Remonumentation
Fee Group Under Act 345 Of
P.A. Of 1990 On 10/31 1997
W.L. Davis, P.S.
Chairman

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
MENOMINEE
(County)

Located in: Corner Code #

1. Public Land Survey T34N R 27W E/E-03
T R (003)
T R
T R

2. Property Controlling in Section S T R
S T R

3. Miscellaneous Property in Sec. S T R
S T R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

97 NOV 21 PM 3:29
SARAH J. JOHNSON
REGISTERED PROFESSIONAL SURVEYOR
No. 26061
Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

I, William Lenca, in a field survey on June 11, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1848: Original Survey by James H. Mullett - B.T.'s - Lynn, 10" - N82.5°E - 27 lks.; W. Ash, 12" - S75°E - 30 lks. All original evidence for this corner has been destroyed by dam construction and shoreline erosion.
- 1900: Survey by Albert Hass, County Surveyor, shows a subdivision of Section 9 and states "Set Meander Post, 4" cedar post, from Government B.T."

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


We re-established a position for this corner by extending a line over corners G-3 and F-3 West to the River. This position falls on line with a 20" diameter Basswood tree which has a very old blaze about chest high on the high bank of the Menominee River. Our distance to this location is about 87 feet short of that shown by the GLO Notes and by Albert Hass due to dam construction and widening of the Menominee River at this location. We accepted the intersection of the High bank with a straight line extension over corners G-3 and F-3 as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Set 2" dia. Aluminum Pipe/3-1/4" dia. Alum cap stamped for corner location:

8" dia. Norway	N28°E	33.78 feet	Scr. NBT
5" dia. Norway	N78°E	20.01 feet	Scr. NBT
7" dia. Norway	S07°W	16.38 feet	Scr. NBT
20" dia. Basswood	West	4.09 feet	Scr. NBT
Metal Survey Sign Post	S70°E	1.5 feet	
High bank of River	West	9.0 feet	

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca Date Oct. 07, 1997
Surveyor's Michigan License No. 26461

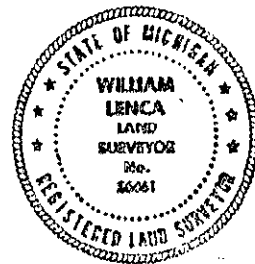

537