

FEB 11 1998

Approved by Menominee County
Land Survey Remonumentation
Peer Group Under Act 345 Of
P.A. of 1996 On 12/30 1997
Mike Adams RLS
Chairman

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
MENOMINEE
(County)

Located In: Corner Code #

1. Public Land Survey T35N R 29W K-10
T___ R___
T___ R___
T___ R___

2. Property Controlling in Section S___ T___ R___
S___ T___ R___

3. Miscellaneous Property in Sec. S___ T___ R___
S___ T___ R___

97 DEC 30 PM 4:06
BARBARA JOHNSON
REGISTER OF DEEDS
MICHIGAN

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

I, William Lenca, in a field survey on Sept 18, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1852: Original Survey by FRANCIS COLEMAN - B.T.'s - Y. Pine, 14" - N59°W - 51 lks.; Y. Pine, 14" - S50°E - 12 lks. All original evidence for this corner has been destroyed by county road improvements.
- 1945: M. S. McNabb in his retracement of several corners in this area, indicates this corner was established in the center of a North - South County Road and in line with fences East - West.
- 1966: N.T. Thompson, RLS No. 4348, shows corner in c/1 of N-S Co. Rd. and in line with fence on North Line of Co. Rd. West - TIES: Cor of Fence - N88°W - 23' (not fd.); Oak Tree, 10" - S71°E - 37.8' (not fd.)
- 1974: Certified Survey No. 30 by George Wilson states "found an old pin 7" below road" 2684.23' south of section corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found "I" Iron with Wilson cap in location as described in Certified Survey No. 30. This position fits well with M.S. Mc Nabb's 1945 record and with the 1966 survey by N.T. Thompson. The corner falls in centerline of a county road running north and south and in line with an old fence along the North Line of an old road to the west. This corner has been accepted and used by local surveyors for many years, and is accepted as the best available evidence of the position of the original corner.

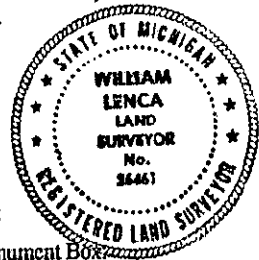

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Accepted existing iron and set 5/8" x 24" Iron Rod/3-1/4" dia. Alum. cap stamped for corner location in Monument Box

6" dia. White Pine	N46°E	57.20 feet	Scr. NBT
7" dia. White Pine	S43°E	34.06 feet	Scr. NBT
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	S89°W	32.09 feet	1.5' S. of Tel. Box
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	N31°W	48.30 feet	1.4' N. of 24" Walnut
Metal Survey Sign Post	East	33.0 feet	

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca
Surveyor's Michigan License No. 26461

Date Sept 30, 1997