


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Menominee
(County)

Located In:	Corner Code #
T 36N R 25W	112
T 36N R 25W	J11
T 36N R 25W	K12
T R	
T R	
T R	
T R	

- Public Land Survey
- Property Controlling in Section
- Miscellaneous Land Property in Section
- No. 37270 Recorded Plat
- Private Land Survey

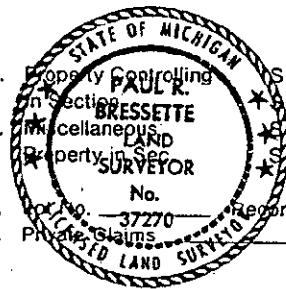

96 JAN -3 AM 10:53
RECEIVED FOR RECORDS
FILE # 322 BK 4
BARBARA JOHNSON
REGISTER OF DEEDS
MENOMINEE COUNTY

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	16	17	18	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							

K12 May 03, 1995
J11 February 28, 1995

I, Paul R. Bressette, in a field survey on 112 April 27, 1995, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- (I12) Quarter corner common to Sections 34 and 35. 1848: James H. Mullett, DS. Set wood post witnessed by: Hemlock 6 S28W 09 lks.; Hemlock 6 N77E 11 lks. 1964: Billy D. Buckler, RLS. Set 1" iron pipe with 4" aluminum cap mid-point and on-line between the Northwest and Southwest corners of Section 35 witnessed by: 14" R. Pine N34W 35 lks.; 14" R. Pine S40E 51 lks.; 8" R. Pine N82E 43 lks. Recorded in Volume 3 p.413 Menominee County Records.
- (J11) Quarter Corner common to Sections 26 and 35. 1848: James H. Mullett, DS. Set wood post witnessed by: W. Pine 16 S04E 75 lks.; Aspen 8 S21W 30 lks. 1955: Billy D. Buckler, RLS. Set 1" iron pipe with 4" brass cap from original white pine bearing tree, witnessed by: 14" W. Ash S50E 28 lks.; 10" W. Ash N03E 76 lks. Recorded in Volume 2, number 87 in Menominee County Records.
- (K12) Quarter corner common to Sections 35 and 36. 1848: James H. Mullett, DS. Set wood post witnessed by: Birch 14 S12W 25 lks.; Hemlock 11 S48E 16 lks.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (I12) Found two of Buckler's witnesses as described, monument was missing. Witness described as 14" R. Pine S40E was found to be a W. Pine, now dead, but standing with faces open and scribing plain. Other two witnesses are in excellent condition with blazes partly open and scribing visible. A new DNR monument (1" iron pipe w/ 4" aluminum cap) was set from NBT's and re-witnessed, and is accepted as a careful and faithful REESTABLISHMENT of the position of the original corner. Monument falls in east wheel track of a woods road.
- (J11) Found monument as described next to a wood post. Both NBT's are gone. Distances east and west check well with distances from 1955 survey (east 1955 - 2664.42', 1995 - 2663.86'; west 1955 - 2685.54', 1995 - 2684.41'). Monument was re-witnessed as found, and is accepted as a careful and faithful PERPETUATION of the position of the original corner.
- (K12) No evidence of original survey or restoration found. Corner position set mid-point and on-line between the Northeast and Southeast corners of Section 35, and is accepted as a careful and faithful REESTABLISHMENT of the position of the original corner. Corner falls in a clearcut.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | | |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| (I12) 1" iron pipe w/ 4" aluminum cap
13" R. Pine N86E 28.4' old NBT
12" R. Pine S30E 39.3' (1/4S, NBT)
08" R. Pine S33W 50.15' (1/4S, NBT)
18" R. Pine N30W 23.1' old NBT
All NBT's are blazed, scribed, painted and tagged. A metal post with sign was placed East 6 feet from monument. Distances are measured from notch in butt blaze, bearings are magnetic. | (J11) 1" iron pipe w/ 4" brass cap
05" Balsam N16E 37.3' (1/4S, NBT)
10" W. Ash N47E 17.7' (1/4S, NBT)
07" R. Maple S70E 28.5' (1/4S, NBT)
06" W. Ash S01W 41.85' (1/4S, NBT)
All NBT's are blazed, scribed, painted and tagged. A metal post with sign was placed next to corner. Distances are measured to notch in butt blaze, bearings are magnetic. | (K12) 1" iron pipe w/ 4" aluminum cap
9" Spruce S82E 60.1' (1/4 S, NBT)
10" Spruce S18E 60.7' (1/4 S, NBT)
7" Balsam S55W 11.85' (1/4 S, NBT)
11" Spruce N69W 45.95' (1/4 S, NBT)
All trees are blazed, scribed, painted and tagged. A metal post with sign was set next to monument. Distances measured to notch in butt blaze, bearings are magnetic. |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|

Signed by Paul R. Bressette Date 1-3-96
Surveyor's Michigan License No. 37270