## SURVEY & REMONUMENTATION

## JAN 09 2001

## SECTION

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

	y Menominee County			
Land Surve	y Remonumentation			
Peer Group Under Act 345 of				
P.A. Of 1999, On 12/22, 20				
///6	WHUII PCCS			
Chairman				
Bk. 6	Px. 203			

MENOMINEE	Located in:	Corner Code #
(County)		
Public Land Survey	T <u>38N</u> R TR TR	26W C-09
Property Controlling     in Section     Miscellaneous     Property in Sec.	STR STR STR STR	


RECEIVED FOR RECORD
28 DEC 2000 2:31:31 PM
BARBARA MORRISON
REGISTER OF DEEDS
MENOMINEE. MI 49858

Register of Deeds Stamp & File Number

4. LOI NO	, Recorded Plat	
5. Private Claims		
	<del></del>	

William Lenca , in a field survey on Sep. 05 , 19 00 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

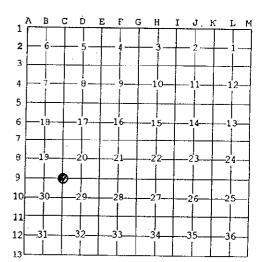

A. Description of original monument and accessories and/or subsequent restoration:

Original Survey by George Adair - B.T.'s - Spruce, 10" - N28°E - 22 lks; Tamarack, 9" - S57°W - 15 lks. All original evidence for this corner has been destroyed by County Road improvements.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We found a Railroad Spike in the center of a 4 way County Road intersection. My private records indicate that this Railroad Spike was set for the Section corner position in a 1995 Survey and subdivision of Section 20, T38N-R26W. This position fits well with measurements to corners 1/2 mile East, 1/2 mile West and 1/2 mile North, and is accepted as the best available evidence of the position of the original corner.

WILLIAM LINCA LAND SURVIVOR OF SURVIVOR OF

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 24" Iron Rod/3-1/4" dia. Alum. cap stamped for corner location in Monument Box:

5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER" Base of Steel Post for Stop Sign		64.27 feet 41.81 feet	@ Survey Sign Post
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER" 5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER" Metal Survey Sign Post	S47°W N49°W N49°E	49.43 feet 42.07 feet 64.8 feet	1.4' E. of Power Pole 1.0' E. of Power Pole

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by (1) Many Back	Date	Sept. 8, 2000
Surveyor's Michigan License No. 26461		