

SURVEY & REMONUMENTATION

945

DEC 07 1994

LIBER 290 PAGE 22

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MISSAUKEE COUNTY MICHIGAN

RECORDED **OCT 28 1994** ¹¹⁵/₁₀ AM

Paulyn Flare
REGISTER

Register of Deeds Stamp & File Number

| | | |
|---------------------------------------|--------------------------|---------------|
| Missaukee <small>(County)</small> | Located In: | Corner Code # |
| 1. Public Land Survey | T <u>21N</u> R <u>8W</u> | C-9 |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 4. Lot No. _____, Recorded Plat _____ | | |
| 5. Private Claims _____ | | |

| | A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|----|---|----|---|----|---|----|---|----|---|----|---|---|
| 2 | 6 | | 5 | | 4 | | 3 | | 2 | | 1 | | |
| 3 | | | | | | | | | | | | | |
| 4 | 7 | | 8 | | 9 | | 10 | | 11 | | 12 | | |
| 5 | | | | | | | | | | | | | |
| 6 | 18 | | 17 | | 16 | | 15 | | 14 | | 13 | | |
| 7 | | | | | | | | | | | | | |
| 8 | 19 | | 20 | | 21 | | 22 | | 23 | | 24 | | |
| 9 | | | | | | | | | | | | | |
| 10 | 30 | | 29 | | 28 | | 27 | | 26 | | 25 | | |
| 11 | | | | | | | | | | | | | |
| 12 | 31 | | 32 | | 33 | | 34 | | 35 | | 36 | | |
| 13 | | | | | | | | | | | | | |

I, J. Dean Geers, in a field survey on October 7, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- C-9) 1853 GLO post by John Brink, Deputy Surveyor
Beech 20 S 8 3/4 E 37, Beech 15 S 60 3/4 W 22
- C-9) 1893, 1897 Beuthien Surveys: Corner was used but no witnesses given
- C-9) 1899 Beuthien Survey in Section 29: Maple 14 S 75 1/2 W 96, Maple 14 S 22 E 58.7, Maple 12 S 78 1/4 E 103.7
- C-9) 1909 Cavanagh Survey in Section 20: Corner fence post N 34 1/2 E 69', Elm 8 S 67 1/2 W, 103 1/2'
- C-9) 1973 J. Erickson LCRC, Liber 1, Page 113: Found 1/2" bolt/nail in centerline intersection
- C-9) 1973 D. Verba LCRC, Liber 1, page 129: Found 3/8" Iron at centerline intersection

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- C-9) Section corner common to Sections 19, 20, 29 and 30

Found pk nail in the centerline intersection of North-South and East-West roads. Corner fits witnesses per LCRC, Liber 1, Page 129. This corner is accepted as a careful and faithful perpetuation of the position of the original corner.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- C-9) Set 1/2" Iron in monument box
S 32 E - 46.09 - Post
S 36 W - 77.65 - P. Pole
North - 100.07 - Set Iron in centerline of road
South - 100.00 - Set Iron in centerline of road

Peer Group Reviewed and Approved

Date: 10-26-94
J. Dean Geers

J. Dean Geers, Missaukee Co. Representative

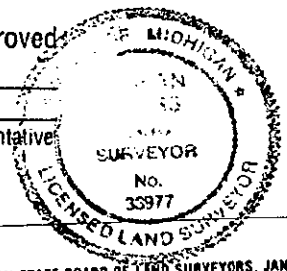

Signed by *J. Dean Geers*

Date 8/8/94

Surveyor's Michigan License No. 33977