

SURVEY & REMONUMENTATION

#954

DEC 07 1994

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 590 PAGE 31

COMMISSION

For corners in

<u>Missaukee</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>21N</u> R <u>8W</u>	<u>L-9</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

MISSAUKEE COUNTY MICHIGAN

RECORDED **OCT 28 1994** 4¹⁵ PM

Carolyn Flare
REGISTRAR

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	I
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, J. Dean Geers, in a field survey on October 7, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- L-9) 1853 GLO Quarter Section post by John Brink, Deputy Surveyor
Birch Ash 10 S 28 E 13, Birch Ash 10 N 73 W 29
- L-9) 1890 Beuthien Survey: Iron Post; Tele Pole N 37 1/2 W 35.7'
- L-9) 1978 M. McClung LCRC Liber 1, Page 566: Found Iron and cap; P.P. N 40 W 55.23, 16"
Willow S 05 W 64.10'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- L-9) Quarter corner common to Sections 24 and 25
Found 3/8" Iron per Liber 1, Page 566 and is accepted as a careful and faithful perpetuation of the position of the original corner. Corner is in the Centerline of the East-West road and in Centerline of road to the North.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- L-9) Set 1/2" Iron and Missaukee Co. monument in monument box
N 20 E - 74.87 - Set Iron @ back of curb at radius point
N 74 E - 69.90 - Set Iron @ back of curb at radius point
N 15 W - 73.07 - Set Iron @ back of curb at radius point
N 65 W - 75.49 - Set Iron @ back of curb at radius point
S 10 W - 61.95 - 18" Willow

Peer Group Reviewed and Approved

Date: 10-21-94
J. Dean Geers
J. Dean Geers, Missaukee Co. Representative

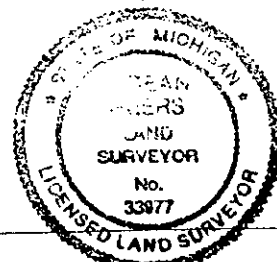

Signed by *J. Dean Geers* Date 8/8/94
Surveyor's Michigan License No. 33977