

**SURVEY &
REMONUMENTATION**

JAN 27 1999

LIBER 323 PAGE 1240

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

#1291

For corners in

<u>Missaukee</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>22N</u> R <u>06W</u>	<u>K-13</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

MISSAUKEE COUNTY MICHIGAN
RECORDED NOV 13 1998 9:50 A.M.
Carolyn Flare
REGISTER

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

I, J. Dean Geers, P.S., in a field survey on June, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- K-13) 1837 GLO Section Post by John Brink, Deputy Surveyor; Birch 12-N31E-14, Hemlock 12-N79W-12
- K-13) 1980 Wilcox LCRC, Liber 1, Page 595, Set Rerod by single proportion on town line. Fits line stumps east, west and north. Poplar 6-South-44.13, Poplar 6-S55W-63.81, Poplar 6-S23E-49.72, White Birch 6-S47E-86.76
- K-13) 1987 DNR LCRC, Found Rerod set by Wilcox and added 1/2" x 36" Pipe. Poplar 6-S55W-63.81, Poplar 6-S02W-44.10, White Birch 7-S45E-86.80, Red Pine Stump 24-S25W-92.2, E-W trail-South-± 17

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- K-13) Section Post common to Sections 35 and 36, T22N, R6W and Sections 1 and 2, T21N, R6W; Found 1/2" rebar inside pipe as recorded in Liber 1, Page 595. This corner is accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


- K-13) Set Missaukee County Monument on existing iron and added new pipe around existing pipe.

N84E	128.43	5" Oak
S75E	152.24	9" Oak
S12E	46.44	Pine stump
S10E	49.08	3" Tag Alder
West	102.01	6" Jack Pine
South	19.0	Centerline trail

Peer Group Reviewed and Approved

Date: 10-21-98
J. Dean Geers
J. Dean Geers, Missaukee Co. Representative

Signed by _____
Surveyor's Michigan License No. 33977

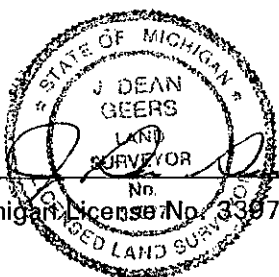

Date 11-2-98