

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

#1234

<u>Missaukee County</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 22N R 7W	M-7
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

LIBER 315 PAGE 112

MISSAUKEE COUNTY MICHIGAN

RECORDED DEC 29 1997 120

*Carolyn Klare*  
 Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, Daniel E. Schripsema, in a field survey on October 1, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate**

	A	B	C	D	E	F	G	H	I	J	K
1											
2	6			5		4		3		2	
3											
4	7			8		9		10		11	
5											
6	18			17		16		15		14	
7											
8	19			20		21		22		23	
9											
10	30			29		28		27		26	
11											
12	31			32		33		34		35	
13											

A. Description of original monument and accessories and/or subsequent restoration:

- M-7) 1837 GLO survey set corner post sections 13, 24; Tamarack 8 S3 1/2E 4, White Pine 11 N32 1/2W 3.10
- 1913 Beuthien survey, FB #33, pg. 68, county surveyor notes; W. Pine 16 N36W 3.10
- 1898 Beuthien survey, FB #37, pg. 75, county surveyor notes; W. Pine 16 N36W 3.10, corner is creek under East end of bridge near south side
- 1976 Jerry L. Wilcox LCRC, #193; Fd. 1" iron; S80W SE Cor. Bridge Abutment 115.1, S20E E Stop Sign post 57.8
- 1980 Jerry L. Wilcox LCRC, #599; Set 1/2" rerod S45W 1/2" rerod 42.63, N86W 1/2" rerod 41.35, N86W Chiseled "X" end of east bridge abutment 108.77, S86W Chiseled "X" end of east bridge abutment 108.58, S80-21-42E 1" Iron Pipe 6.76
- 1976 Jerry L. Wilcox survey, liber S-1, pg. 248; Fd. 1" iron, S80W SE. cor. conc. bridge abutment 115.1, S20E Stop Sign Post 57.8
- 1980 Jerry L. Wilcox survey, liber S-2, pg. 3; same as record LCRC #599

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-7) Corner common to Sections 13 & 24, T22N, R7W and Sections 18 & 19, T22N, R6W. Found 1/2" rerod of record (LCRC #599). Iron pipe found S80E 6.76' was not accepted as corner but was left in place as a witness.  
 This corner is accepted as a careful and faithful reestablishment of the position of the original corner.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-7) Set Missaukee County Monument on exiting 1/2" rerod. Corner is 6' +/- West of centerline intersection of roads South, East & West  
 S80E 6.76' 1" iron pipe  
 S45W 42.63' 1/2" rerod  
 N86W 41.35' 1/2" rerod  
 N86W 108.77' chiseled "x" end of east bridge abutment  
 S86W 108.58' chiseled "x" end of east bridge abutment

Peer Group Reviewed and Approved  
 Date: 12-23-97  
 J. Dean Geers, Missaukee Co. Representative

Signed by *Daniel E. Schripsema*  
 Surveyor's Michigan License No. 24617

Date 12-2-97

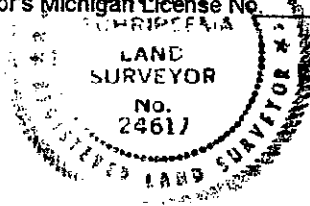

**SURVEY & MONUMENTATION**  
**JAN 16 1998**  
 SECTION