

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Missaukee County Located In: Corner Code #
 (County)

1. Public Land Survey T 23N R 6W M-1
 T ___ R ___
 T ___ R ___
 T ___ R ___

2. Property Controlling S ___ T ___ R ___
 in Section S ___ T ___ R ___

3. Miscellaneous S ___ T ___ R ___
 Property in Sec. S ___ T ___ R ___

1011
 LIBER 315 PAGE 1113

MISSAUKEE COUNTY MICHIGAN
 RECORDED DEC 29 1997 ¹⁰⁵ P.M.
Carolyn Flare
 REGISTER
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Daniel E. Schripsema, in a field survey on October 1, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- M-1) 1839 GLO survey set corner post section 1; need more GLO
- 1895 County surveyor's record, FB #17, pg. 65; 22" diameter Hemlock named corner
- 1912 County surveyor's record, FB #24, pg. 53; Tree removed and replaced with 4" square cedar stake
- 1968 Gene Ostling, set 1/2" rerod
- 1992 Carl F. Roser LCRC, #858; Fd. 1/2" rerod
- 5" Maple N45W 63.0', P. Pole N60E 35.88', NW Cor. Wood frame cabin S80E 70.7', 3" Balsam S57W 45.6', Set Cedar Post w/ loc. Tag by Fd. 1/2" rerod West 33.0'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- M-1) Corner common to Section 6, T23N, R6W, Section 1, T23N, R7W, Section 31, T24N, R6W and Section 36, T24N, R7W
- Found 1/2" rerod of record in LCRC #858, in centerline of N & S road and 50 south of trail road west. This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- M-1) Set Missaukee County monument over existing rerod with Monument box added.
- N56E 35.88' power pole - fd. Pk nail
- S82E 70.66' NW cor. cabin
- N47W 62.94' 6" maple, fd. nail
- S54W 45.63' 4" balsam, fd. nail
- S89W 32.74' DNR post

Peer Group Reviewed and Approved
 Date: 12-15-97
J. Dean Beers
 J. Dean Beers, Missaukee Co. Representative

Signed by *Daniel E. Schripsema* Date 12-2-97
 Surveyor's Michigan License No. 24617

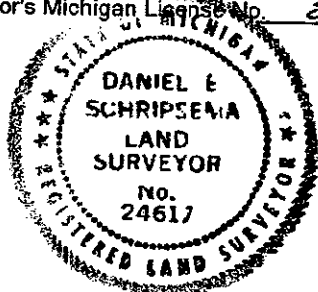

SURVEY & REMONUMENTATION

JAN 16 1998

SECTION