

SURVEY & REMONUMENTATION

APR 24 1995

LIBER 291 PAGE 443

987

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in **COMMISSION**

<u>Missaukee</u> <small>(County)</small>	Located In:	Corner Code #
	23N 7W	G-13
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

MISSAUKEE COUNTY MICHIGAN

RECORDED **JAN 23 1995 12⁰¹ PM**

Register of Deeds Stamp & File Number

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	13	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Daniel E. Schripsema, on a field survey on December, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- G-13) 1853 GLO post by John Brink, Deputy Surveyor
 Beech 9 N 21 1/2 W 46,
 Beech 9 N 61 1/2 E 35
 - G-13) 1889 County Survey Records
 Stone
 W.P.S. 44 N59W 51
 W.P.S. 30 N30W 104
- Cont' on back

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- G-13) Section corner common to Sections 33 and 34

Found 1 5/8" bar in monument box per Liber 1, page 813 and is accepted as a careful and faithful perpetuation of the position of the original corner. Corner is located in the centerline of the North-South road and 0.5' S. of the centerline of the East-West road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


- G-13) Raised existing 1 5/8" Bar in monument box with 5/8" Iron with 2 1/2" brass Missaukee County monument.

- N 38 W 63.76 Tel. Ped. Post
- N 01 W 51.05 1 1/2" pipe
- N 35 E 59.69 Fe. Cor. Post
- S 34 E 60.73 Capped Iron #24617
- S 33 W 59.55 Tel. Ped. Post

Peer Group Reviewed and Approved

Date: 11-2-94
J. Dean Geers
 J. Dean Geers, Missaukee Co. Representative

Signed by Daniel E. Schripsema
 Surveyor's Michigan License No. 24617

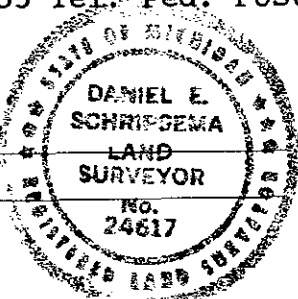

Date 12-30-94