

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 24 N. R. 7 W. ●	H-7; I-8; I-9
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on November 30, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- H-7** Fd. crooked piece of iron rod (hit by grader) below surface of sealcoat road; replaced with 5/8"x36" rerod; fits ctr. of E-W road & split of E-W ROW fences & is in line with old fence to N & split of old ROW fences & twp. road grade to S.. Corner location & old fences attested to by old local citizen, Harold Frye.
- I-8** Reestablished 1/4 corner equidistant & on line between section corners 1/2 mile N & 1/2 mile S. Corner is 2'± east of center N-S gravel road.
- I-9** Reestablished section corner at prorated distance N & S to US; between fd. 1/4 corner 1/2 mile S & fd. section corner 1 mile N; & in approximate center of N-S gravel road. Fence remains to east are 56'± to south.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

	H-7	I-8	I-9
Fd. old iron rod; replaced with 5/8"x36" rerod		Drove 1 1/4"x18" solid iron rod	Drove 1 1/4"x20" solid iron rod
P. Pole S10°E 92.15	P. Pole N55°E 39.19	7" Twin Maple N55°E 69.0	
"T" sec. st. fn. post in old cor.	21" Maple S70°W 45.97	7" Maple N75°W 103.2	
fn. post hole Due N 25.9	5" Maple S55°E 55.40	7" Maple S70°W 93.5	
Cor. fits 1909 wit. by Co. Surv.	set ced. post w/loc. tag	Set cedar post w/loc. tag	
<b>J.G. Cavanagh</b> ; Beech (stump), N70 1/2°E 115 links	Due W 33'	Due W 33'	
	Ctr. of drive to E		
	Due N 15'±		

SIGNED BY Carl F. Roser DATE 02/17/80

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

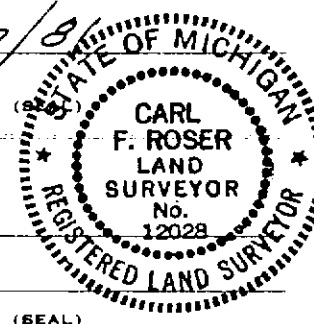

(SEAL)

MISSAUKEE COUNTY  
PIONEER TOWNSHIP

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_