

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 24 N. R. 7 W.	F-13; I-13; K-11; K-13
2. PROPERTY CONTROLLING IN SECTION	T. S. R. E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on December 10, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

C. (continued)

	K-13
Fd. 1/2" Rerod w/RLS Cap over 1" Pipe in Conc.	
30" Maple	Due N 36.6
*20" Beech	S60°E 46.4
14" Beech	S30°W 53.9

Set cedar post w/loc. tag Due N 33'
*Probable 1909 Cavanagh B.T.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- F-13** Found iron as established by RLS J. Wilcox.
- I-13** Found 3/4" pipe 2'± south of intersection of gravel roads N-S & E-W.
- K-11** Fd. conc. mon. per J. G. Cavanagh 1909 survey. This corner also used by J. Wilcox in subdividing Sec. 25. Corner falls on N edge of old E-W RR grade.
- K-13** Fd. 1/2" rerod by RLS L. L. Cavanagh (survey of Sec. 36, T24N-R7W in 1972 for "Trent's Resort Properties"), over old conc. mon. per J. G. Cavanagh 1909 survey. Corner is in line with old fence to N & is 33' S of old E-W ROW fence.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-13	I-13	K-11
Fd. 1/2"x18" Rerod (buried 0.3) w/RLS Cap	Found 3/4"x30" Pipe	Fd. 1 1/2" pipe in conc. & set cedar post w/loc. tag
4" Maple S18°W 56.38	P.Pole S60°W 40.47	11" Twin Maple N75°W 30.88
12" Maple N53°E 46.25	5" R. Pine N34°W 63.50	8" Trpl. Maple N73°E 5.66
13" Maple N03°E 30.43	18" Maple N50°E 73.90	8" Twin Maple S42°E 12.15
8" Maple N32°W 39.95	Set cedar post w/loc. tag	6" Maple S15°E 8.22
ctr. E-W grav. rd. Due S 5'±	S45°E 47'	11" Twin W. Birch S33°W 28.30
Set ced. post w/loc. tag N 33'		

SIGNED BY Carl F. Roser DATE 5-13-81

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

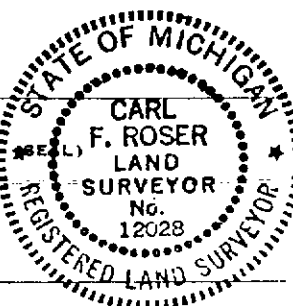

(SEAL)

MISSAUKEE COUNTY
PIONEER TOWNSHIP

SURVEYOR'S MICHIGAN REGISTRATION NO. _____