

SURVEY & REMONUMENTATION

FEB 06 1998

Montmorency County Remonumentation Liber 00012 Page 0287

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>MONTMORENCY</u> (County)	Located In:	Corner Code #
<u>ALBERT TWP.</u>	T <u>29N</u> R <u>1E</u>	<u>G - 8</u>
1. Public Land Survey	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

STATE OF MICHIGAN
MONTMORENCY COUNTY
Recorded & Filed

12-16-1997 10:52:11

A. FANGAN-MCELROY
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, DONALD E MARLATT in a field survey on 6/11, 1997 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G - 8 1/4 COR. COMMON TO SEC.'S 21 & 22.
GLO CORNER SET BY LEWIS CLASON APRIL 1840. SPR.PINE 8"-S48°E 12 L., SPR.PINE 6" N64°W 17 L. F.SMITH NOTES 8/20/31. CEDAR STK. 8"OAK S70°30' 49', 10"OAK S58°30'E 82.43', 6"OAK N47°30'W 54.97'.
JOHNS SUBDIVISION BY S. THORSEN 8/14/57. L. 2 OF PLATS, P. 14.
SURVEY BY N.C.CALDWELL 4/17/71. L. 1, P. 164.
SURVEY BY R.S.SCOTT ENG. CO. INC. 6/7/71. FD. CORNERS & RLS CAPS.
SURVEY BY R.S.SCOTT ENG. CO. INC. 10/25/73. L. 1, P. 452. FD. RECORD CORNER.
SURVEY BY R.S.SCOTT ENG. CO. INC. 11/7/75. L. 2, P.131. FD. RECORD CORNER.
SURVEY BY R.S.SCOTT ENG. CO. INC. 8/16/77. L. 2, P. 340. FD. RECORD CORNER.
SURVEY BY D.E.MARLATT 11/27/77. L. 2, P 418. MON. BOX 1/2"RODS EAST & WEST.
SURVEY BY D.E.MARLATT 8/5/85. MON. BOX. 1/2"RODS EAST & WEST.
SURVEY BY R.S.SCOTT ASSO. INC. 1/13/92. L.4, P. 31. FD. 1/2"BAR & CAP IN MON. BOX. N85°W P.POLE 45.45', EAST T.POLE 32.18', N55°E P.POLE 62.67', S40°E 6"TW.OAK 74.37'.
SURVEY BY R.S.SCOTT ASSO. INC. 5/18/92. L. 4, P. 41.(COR. & WIT. SAME AS ABOVE.)
SURVEY BY D.E.MARLATT 7/13/93. (CORNER & WIT. SAME AS ABOVE).

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

G - 8 1/4 CORNER COMMON TO SEC.'S 21 & 22.
FD. 1/2"ROD & CAP IN MON. BOX.
S80°E T.POLE 32.2', N63°E P.POLE 62.67', N77°W P.POLE 45.45', S27°E 7"OAK 74.38'(BEAUREGARD).


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-8 1/4 COR. COMMON TO SEC.'S 21 & 22.
PLACE REMON. CAP ON 1/2"ROD IN MON. BOX.
S86°E T.P. 32.2'
N63°E P.POLE 62.67'
N77°W P.POLE 45.45'
S27°E 7"OAK 74.38'
N63°E 12"N.PINE 42.43'

**APPROVED BY
PEER GROUP**

JUN 20 97

D.E.B.

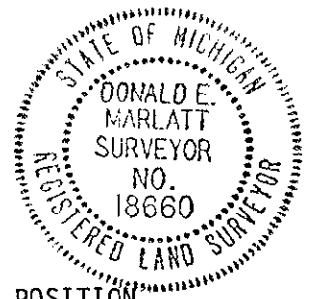

WITNESSES MARKED WITH 40 PENNY SPIKES & P.S. TAGS #18660.
APPROVED BY PEER GROUP JUNE 20, 1997 AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

Signed by Donald E Marlatt Date 12/15/1997
Surveyor's Michigan License No. 18660