

SURVEY & REMONUMENTATION

FEB 0 6 1998

Montmorency County Remonumentation

Liber **00012** Page **0282**

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in **SECTION**

<u>MONTMORENCY</u> (County)	Located In:	Corner Code #
ALBERT TWP.	T <u>29N</u> R <u>1E</u>	<u>H - 7</u>
1. Public Land Survey	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

STATE OF MICHIGAN
 MONTMORENCY COUNTY
 Recorded & Filed

12-16-1997 10:51:13

A. PANGAN-MCELROY
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, DONALD E MARLATT, in a field survey on 8/20, 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													


NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
 - H-7 1/4 COMMON TO SEC.'S 15 & 22.
 - GLO COR. SET BY LEWIS CLASON APRIL 1840. SPR.PINE 9"-S55°E-35 L., SPR.PINE 6"-N65°W-15 L.
 - F. SMITH NOTES. FD OLD POST. SET CEDAR POST 7/25/47. 28' SOUTH OF OLD FENCE.
 - S20°W 75.35' 8"OAK, N23°W 25.24' 3"OAK.
 - SURVEY BY N.C.CALDWELL JUNE 1969. FOUND RECORD POST & 1"PIPE-RAISED WITH 1/2"BAR.
 - S20°W 75.3' 12"OAK NBT, N23°W 25.5 8"OAK NBT, NORTH 33' 1/2"BAR.
 - ACT 74 BY N.C.CALDWELL 8/7/72. L. 1., P. 27. FD. WOOD POST OF RECORD AND SET 1/2"BAR AND RLS CAP. S20°W 75.3' 12"OAK R., N23°W 25.5' 8"OAK R.
 - SURVEY BY R.S.SCOTT ENG. CO. INC. 1/2/75.
 - SURVEY BY R.S.SCOTT ENG. CO. INC. 11/7/75 L. 2, P. 131. FOUND RECORD CORNER.
 - SURVEY BY D.E.MARLATT 11/27/77. L. 2, P. 418. FD. 1/2"ROD. NORTH 33' 1/2"ROD.
 - SURVEY BY D.E.MARLATT 9/15/78. L. 2, P. 469. FD. 1/2"ROD. NORTH 33' 1/2"ROD. N65°W 7"N.PINE 81.85'.
 - SURVEY BY D.E.MARLATT 9/20/83. FD. 1/2"ROD. S20°W 75.3' 12"OAK, N23°W 25.2' 6"OAK, N. 33' 1/2"ROD.
 - SURVEY BY R.S.SCOTT ASSO. INC. 11/20/92. L. 4, P. 82. FOUND 1/2"BAR IN MON. BOX(RLS CAP) NORTH 100.6' 12"N.PINE(R), N75°W 82.27' 8"N.PINE(R), S45°W 68.08' 6"APPLE IN CLUMP.
 - ACT 74 BY L. BEAUREGARD 11/20/92. L.1, P. 489. SET 1/2"BAR & RLS CAP 18654 IN MON. BOX. NORTH 100.6' 12"N.PINE, N75°W 82.27' 8"N.PINE, S45°W 68.08' 6"APPLE IN CLUMP, S35°W 83.35' 6"J.PINE.
 - SURVEY BY D.E.MARLATT 8/6/1996. L. 10004, P. 387-389. (WITNESSES & CORNER SAME AS ABOVE).
- B. Description of corner evidence found and /or method applied in restoring or reestablishing cor.
 - H-7 1/4 COR. COMMON TO SEC.'S 15 & 22.
 - FOUND 1/2"ROD & CAP#18654 IN MON. BOX.
 - NORTH 14"N.PINE 100.55', N61°W 14"N.PINE 82.25', S39°W 10"J.PINE 83.38'. (BEAUREGARD WIT.)
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 - H-7 1/4 COR. COMMON TO SEC.'S 15 & 22.
 - PLACED REMON. CAP ON 1/2"ROD IN MON. BOX.
 - NORTH 14"N.PINE 100.55'
 - N61°W 14"N.PINE 82.25'
 - S39°W 10"J.PINE 83.38'
 - N45°W 8"N.PINE 84.29'

**APPROVED BY
 PEER GROUP**

JUN 20 97

L.S.B.

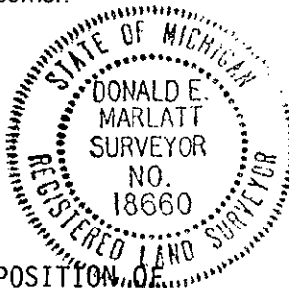

WITNESSES MARKED WITH 40 PENNY SPIKES AND P.S. TAGS # 18660.
 APPROVED BY PEER GROUP JUNE 20, 1997 AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

Signed by Donald E Marlatt Date _____
 Surveyor's Michigan License No. 18660