

**SURVEY &
REMONUMENTATION**

APR 24 1995

Montmorency County Remonumentation

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Liber **00012** Page **0127**

COMMISSION

For corners in

Montmorency
(County)

Located In:
Albert Township

Corner Code #

1. Public Land Survey

T 29 N R 1 E
T 29 N R 1 E

K-13 ✓
L-13

2. Property Controlling
in Section

S _____ T _____ R _____
S _____ T _____ R _____

**APPROVED BY
PEER GROUP**

3. Miscellaneous
Property in Sec.

S _____ T _____ R _____
S _____ T _____ R _____

MAY 13 94

JB

STATE OF MICHIGAN
MONTMORENCY COUNTY
Recorded & Filed

11-10-1994 14:12:14

A. PANGAN-MCELROY
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Don Marlatt, in a field survey on November 8, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	N
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(K-13) South Cor. common to Secs. 35 & 36, T 29 N, R 1 E
Post set by Lewis Clawson Dec. 1839.
8" Spr. Pine N 24° W 40 links
20" J. Pine N 56° E 47 links
N. Caldwell - Survey - L. 1, P. 399.
R.S. Scott Engineering - Survey - 1-18-1974.
R.S. Scott Engineering - Survey - L. 4, P. 83.

(L-13) S. 1/4 Cor. Sec. 36, T 29 N, R 1 E
Post set by Lewis Clawson Dec. 1839.
6" Spr. Pine N 34° W 53 links
6" Spr. Pine N 37° E 21 links
R.S. Scott Engineering - Survey - 1-18-1974.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(K-13) South Cor. common to Secs. 35 & 36, T 29 N, R 1 E
Found 2" pipe in concrete base.
N.W. Cor. Sec. 1, 28/1, 7.92' West.
No evidence of original corner.
Accepted as the best available evidence of the reestablishment of the original corner.

(L-13) S. 1/4 Cor. Sec. 36, T 29 N, R 1 E
Found 1" pipe & square Oak stake.
N. 1/4 Cor. Sec. 1, 28/1, 4.71' West.
No evidence of original corner.
Accepted as the best available evidence of the reestablishment of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K-13) South Cor. common to Secs. 35 & 36, T 29 N, R 1 E
Placed Remonumentation Cap in 2" pipe in concrete.
7" J. Pine S 70° W 32.3'
15" J. Pine S 30° W 29.58'
11" J. Pine S 1° W 30.78'
12" Oak S 89° E 69.2'
10" J. Pine N 9° W 42.4'
Witnesses marked with a 30 penny spike & I.D. tag #18660.

(L-13) S. 1/4 Cor. Sec. 36, T 29 N, R 1 E
Set concrete monument & placed Remonumentation Cap.
10" J. Pine N 21° E 26.12'
10" R. Pine N 89° E 33.74'
15" R. Pine S 23° E 49.27'
14" J. Pine S 3° W 32.63'

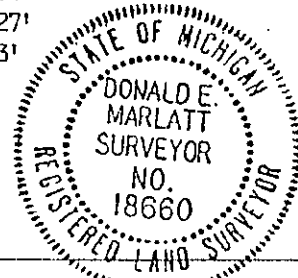

Signed by Donald E Marlatt

Date 11-9-1994

Surveyor's Michigan License No. 18660