

**SURVEY & REMONUMENTATION**

APR 24 1995

**COMMISSION**

Montmorency County Remonumentation

Liber **00012** Page **0130**

**LAND CORNER RECORDATION CERTIFICATE**

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Montmorency (County)	Located In: Briley Township	Corner Code # F-13 <u>G-13</u> ✓
1. Public Land Survey	T 30 N R 2 E T 30 N R 2 E T _____ R _____ T _____ R _____	<p><b>APPROVED BY PEER GROUP</b></p> <p>MAY 13 94</p> <p><i>RB</i></p>
2. Property Controlling in Section	S _____ T _____ R _____ S _____ T _____ R _____	
3. Miscellaneous Property in Sec.	S _____ T _____ R _____ S _____ T _____ R _____	
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

STATE OF MICHIGAN  
MONTMORENCY COUNTY  
Recorded & Filed

11-10-1994 14:12:49

A. PANGAN-MCELROY  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Don Marlatt, in a field survey on November 8, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law: established, re-established, monumented, re-monumented, recovered, found as expressed below.


**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

- |   |  |
|---|--|
| <p>(F-13) S. 1/4 Cor. Sec. 33, T 30 N, R 2 E<br/>Post set by Lewis Clawson 1-10-1840.<br/>24" Y. Pine N 44° E 25 links<br/>24" Y. Pine N 69° W 77 links<br/><br/>DNR Survey - Sept. 1977<br/>Ken Ostling - filed Act 74, L. 1, P. 211.<br/>D. Marlatt - 12-15-93, Survey.</p> | <p>(G-13) South Cor. common to Secs. 33 &amp; 34, T 30 N, R 2 E<br/>Post set by Lewis Clawson 1-10-1840.<br/>24" W. Pine N 22° E 25 links<br/>18" W. Pine N 55° W 46 links<br/><br/>D. Porter - filed Act 74, L. 1, P. 63.<br/>DNR Survey - Sept. 1977<br/>Ken Ostling - Recorded Act 74, L. 1, P. 210.<br/>D. Marlatt - 12-15-93, Survey.</p> |
|---|--|

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

- |   |   |
|---|---|
| <p>(F-13) S. 1/4 Cor. Sec. 33, T 30 N, R 2 E<br/>Found DNR Monument.<br/>6" Maple N 30° E 13.1'<br/>6" W. Oak N 22° W 31.55'<br/>N. 1/4 Cor. Sec. 4, 29/2, 16.2' East<br/>No evidence of original corner.<br/><br/>Accepted as the best available evidence of the reestablishment of the original corner.</p> | <p>(G-13) South Cor. common to Secs. 33 &amp; 34, T 30 N, R 2 E<br/>Found concrete monument.<br/>County Road Commission Notes:<br/>Mon. N 45° E 50' -- Mon. N 45° W 50'<br/>Porter's Act 74: 4" Conc. marker N 45° E 50.1'<br/>15" Oak S 15° W 65.9'<br/>24" Oak West 12.68'<br/>Conc. Mon. East 19.14'<br/>4" Conc. Marker S 30° W 53.85'<br/>Ostling's Act 74: 28" Oak West 11.4'<br/>11" R. Pine N 50° W 23.4'<br/>Conc. Mon. N 45° W 50.2'<br/>Conc. Mon. N 45° E 50.1'<br/><br/>No evidence of the original corner.<br/><br/>Accepted as the best available evidence of the position of the original corner.</p> |
|---|---|

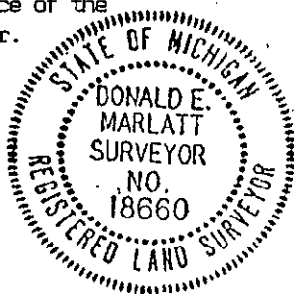

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- |  |   |
|--|---|
| <p>(F-13) S. 1/4 Cor. Sec. 33, T 30 N, R 2 E<br/>DNR Monument.<br/>6" Maple N 30° E 13.10'<br/>6" W. Oak N 22° W 31.55'<br/>8" Oak N 45° W 11.30'<br/>12" Oak North 28.48'<br/>11" Oak N 47° E 34.43'<br/>8" Oak N 73° E 15.53' - N. 1/4 Cor. Sec. 4, 29/2, 13.18' East.</p> | <p>(G-13) South Cor. common to Secs. 33 &amp; 34, T 30 N, R 2 E<br/>Placed Remonumentation Cap on concrete monument.<br/>17" Oak S 22° W 66.15'<br/>15" Oak S 60° W 29.32'<br/>26" Oak N 86° W 11.48'<br/>17" N. Pine N 48° W 23.80'<br/>15" N. Pine S 65° E 18.51'<br/>N.E. Cor. Sec. 4, 29/2, 19.1' East.</p> |
|--|---|

Signed by Donald E. Marlatt

Date 4-9-1994

Surveyor's Michigan License No. 18660

Witnesses marked with 30 penny spike and I.D. tag #18660.