

Montmorency County Remonumentation

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Libel 12 Page 14

08126
RECORDED
NOV 13 1993
REGISTERED
MICHIGAN SURVEYOR

For corners in

Montmorency (County) Located In: Avery Corner Code #/ Briley
 1. Public Land Survey T 30N R 3E A-1
 T 30N R 3E A-2
 T 30N R 2E M-1
 T 30N R 2E M-2
 2. Property Controlling S _____ T _____ R _____ **APPROVED BY**
 in Section S _____ T _____ R _____ **PEER GROUP**
 3. Miscellaneous S _____ T _____ R _____ NOV 05 93
 Property in Sec. S _____ T _____ R _____
 4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2								
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Donald E. Marlatt, in a field survey on December 10, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- | | |
|---|--|
| <p>(A-1) N.W. Cor. Sec. 6, T30N, R3E
 Post set by Lewis Clason 1940.
 B. Oak 8" S 13° W 26'
 Y. Pine 6" S 72° E 26'
 Act 132 Survey by D.E. Porter L. 2, P. 152.
 Act 132 Survey by D.E. Porter L. 1, P. 449.</p> | <p>(A-2) W. ¼ Cor. Sec. 6, T30N, R3E
 Lewis Clason marked Spruce Pine.
 for ¼ post (No witness).
 Act 132 Survey D.E. Porter
 L. 1, P. 449.
 Act 132 Survey D.E. Porter
 L. 2, P. 152.
 Act 132 Survey D.E. Marlatt
 L. 2, P. 596.</p> |
|---|--|

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- | | |
|--|--|
| <p>(A-1) N.W. Cor. Sec. 6, 30-3
 Fnd. conc. Mon.
 West 15" Pine stp. 13.57' (Fd.)
 S 80° W J. Pine stp. 13.8' (Gone)</p> | <p>(A-2) W. ¼ Cor. Sec. 6, T30N, R3E
 Fnd. conc. Mon.
 S 70° E 18" Oak 57.20' (Fd.)
 N 55° E 10" J. Pine 67.09' (Gone)</p> |
|--|--|

No evidence of original corner. No evidence of original corner.

The Peer Group approved (A-1) & (A-2) as the best available evidence of the position of the original corner.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|---|--|
| <p>(A-1) N.W. Cor. Sec. 6, T30N, R3E
 Left conc. Mon. & placed Re-Mon cap.
 West 15" Pine stp. NBT 13.57'
 S 50° E 12" Oak 9.60'
 N 45° E 10" Oak 6.3'
 N 40° W Tw. 9" Oak 4.0'</p> | <p>(A-2) W. ¼ Cor. Sec. 6, T30N, R1E
 Left conc. Mon. & placed Re-Mon cap.
 S 70° E 18" Oak 57.20'
 S 35° W 9" R. Pine 5.97'
 N 65° W 8" R. Pine 16.92'
 N 20° W 8" R. Pine 14.67'</p> |
|---|--|

Note: Witnesses marked with 30 penny spikes & I.D. tags #18660.

Signed by Donald E. Marlatt
 Surveyor's Michigan License No. 18660

SURVEY & Date Dec 15, 1993

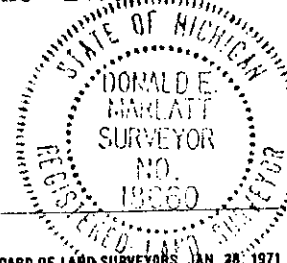

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1989

MAR 03 2000

SECTION