

NEWAYGO COUNTY REGISTER OF DEEDS
 1993 NEWAYGO COUNTY REMONUMENTATION PROJECT
 LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970
 MARLENE TOOGOOD
 94 JAN 21 PM 3 25

For corners in

Newaygo (County) Located In: Corner Code ##

1. Public Land Survey T 12N R 14W B-3
 T _____ R _____
 T _____ R _____
 T _____ R _____

2. Property Controlling in Section S _____ T _____ R _____
 S _____ T _____ R _____

3. Miscellaneous Property in Sec. S _____ T _____ R _____
 S _____ T _____ R _____

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Marlene Toogood
 VOL 001 PAGE 09

Register of Deeds Stamp & File Number

I, Norman L. Ochs, in a field survey on December 15, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

| | A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|----|----|----|----|----|----|---|---|---|---|---|---|---|
| 2 | 6 | 5 | 4 | 3 | 2 | 1 | | | | | | | |
| 3 | 7 | 8 | 9 | 10 | 11 | 12 | | | | | | | |
| 4 | 13 | 14 | 15 | 16 | 17 | 18 | | | | | | | |
| 5 | 19 | 20 | 21 | 22 | 23 | 24 | | | | | | | |
| 6 | 25 | 26 | 27 | 28 | 29 | 30 | | | | | | | |
| 7 | 31 | 32 | 33 | 34 | 35 | 36 | | | | | | | |
| 8 | | | | | | | | | | | | | |
| 9 | | | | | | | | | | | | | |
| 10 | | | | | | | | | | | | | |
| 11 | | | | | | | | | | | | | |
| 12 | | | | | | | | | | | | | |
| 13 | | | | | | | | | | | | | |

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

S $\frac{1}{2}$ Corner, Section 6, Sheridan Twp., Newaygo County, Michigan

A. Description of original monument and accessories and/or subsequent restoration:

- G.L.O. 1837 John Millett
- 6" Beech N25°E 13LKS (8.58') #1
- 18" Beech S67°E 10LKS (6.60') #2
- Lyle S. Shepherd RLS #503
- Field Book 84 Pg. 29
- 1 1/2" Gas Pipe
- 24" Maple S40°W 33.7" #3
- 18" Maple South 24.0' #4
- NCRC Sheet
- 1 1/2" Gas Pipe
- 24" Maple S40°W 33.7' #3
- 18" Maple South 24.0' #4
- MSHD 1 1/2" Well Point
- 20" Maple S02°W 24.38' #5
- 27" Maple S45°W 33.64' #3
- 26" Maple S68°W 52.37' #6

Sept. 16, 1977 N.E. \$S. Co.
 Found Well Point
 20" Maple S02°W 24.37' #5
 8" Apple NE 35.00' #7


Jan. 8, 1987 William Fries Jr.
 RLS #30389 FD 2" OD Pipe LCRC #779
 5" Beech AZ 149° 54.03' #8
 21" Apple AZ 184° 24.93' #5
 27" Maple AZ 243° 50.24' #6
 3" Cherry AZ 327° 96.58' #9

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 Ralph A. Smith did a section break of sec. 6. He set 1 1/2" Gas Pipe. He measured 2758.0 ft. from the S $\frac{1}{2}$ corner to the SW corner and measured 2630.0 ft from the S $\frac{1}{2}$ corner to the SE corner of said section. In 1977 New. Eng. & Sur. Co. found a Well Point. They measured N89°57'19"W 2757.20 ft from the S $\frac{1}{2}$ corner to the SW corner and measured N89°44'03"E 2628.53 ft. from the S $\frac{1}{2}$ corner to the SE corner of said section. In 1987 William Fries Jr. found a 2" OD Pipe 3 ft south of occupied center line of East & West road. He raised it with a 1/2" iron. Found 2" iron raised with 1/2" re-rod Replaced with a 4" Harrison Cast Iron Mon. Condition of recorded witnesses is: #1 & #2 Gone #3 & #4 Good condition. #5 & #6 Good condition. #7 & #8 Good Condition. #9 Gone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set a 4" Harrison Cast Iron Monument as a substantial marker for the $\frac{1}{2}$ corner and is accepted as a careful and faithful re-establishment of the original corner.

- 36" Maple S45°W 33.64' #3
- 30" Maple South 24.38' Spike in East side of tree #4
- 27" Maple AZ 243° 50.24' Spike in NE side of tree #6
- 5" Beech AZ 149° 54.03' Spike in NE side of tree #8
- 1/2" Re-rod with cap #16924 N22°E 37.14

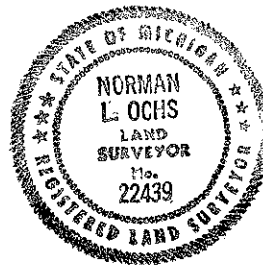

Signed by Norman L. Ochs Date December 28, 1993
 Surveyor's Michigan License No. 22439
 Approved by Peer Review Group on December 29, 1993
 Norman L. Ochs, County Representative

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983

SURVEY &
 REMONUMENTATION

JEC 07 2000

SECTION