

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

VOL 001 PAGE 126

For corners in

Newaygo
(County)

Located In:

Corner Code #

- | | | |
|------------------------------------|---------------------------|------------|
| 1. Public Land Survey | T <u>14N</u> R <u>14W</u> | <u>C-3</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

NEWAYGO COUNTY
REGISTER OF DEEDS
MARLENE TOOGOOD

'95 MAR 14 PM 3 57

Marlene Toogood

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		3		9		10		11		12		
5													
6	10		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Norman L. Ochs, in a field survey on October 6, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

NE Corner, Sec. 7, Denver Twp., Newaygo County MI

A. Description of original monument and accessories and/or subsequent restoration:

- G.L.O. Thomas Welpley 1856
- 16" Hemlock S54-3/4°W 55 lks (36.3') #1
- 30" Beech S23°E 94 lks (64.04') #2
- 14" Beech N22-1/2°W 134 lks (88.44') #3
- 16" Elm N45°E 13 lks (85.8') #4

Delos G. Anderson (Co. Surveyor)
Book A Pg's 267 & 268
August 16, 17 & 18, 1899
Old Gov't Corner Found.
Witness tree there & stake.

Delos G. Anderson (Co. Surveyor)
Book A Pg. 186 May 12, 1897
Fnd. Original Corner.
Witness standing on edge of marsh

Wm. M. Jacques (Co. Surveyor) Aug. 22, 1910
Book B Pg. 30 8" Cedar Stake w/broken glass around stake.
Measured 40.83 chains (2694.78 ft.) from

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 3/4" pipe and broken glass. I measured 2684.93 feet from the NE corner to the E-1/4 cor. of Section 7.


Condition of recorded witnesses is: #1 thru #10 gone, #11 good condition, #12 gone, #13 and #14 good condition.

The corner is in CL of N&S & E&W roads.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Removed 3/4" pipe and set a 4" Harrison Cast Iron Monument 20" long marked "County Surveyor" as a substantial marker for the Section corner and is accepted as a careful and faithful reestablishment of the original corner.

- 16" Ash N40°W 47.43' Spk. on SW side of tree.
- 12" Elm N36°E 31.23' Spk. on SE side of tree.
- 10" Maple S24°E 43.39' Spk. on West side of tree. #13.
- P.Pole N60°W 99.47' Spk. on Nly side of Pole. #11.

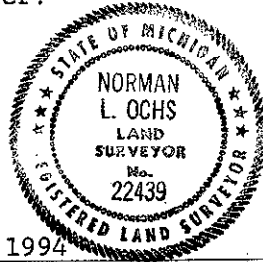

Signed by Norman L. Ochs
Norman L. Ochs 22439

Date October 19, 1994

Surveyor's Michigan License No. _____
Approved by Peer Review Group on November 10, 1994.
Norman L. Ochs, County Representative. *N.L.O.*

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

SURVEY &
REMONUMENTATION
DEC 07 2000
SECTION

A cont.

1949 Ralph A. Smith RLS #3421
Field Book 83, Pg. 23
Iron
16" Oak NE 53.2' #5
14" Maple SE 33.2' #6
20" T. Maple NW 35.2' #7

April 1961 Ralph A. Smith #3421
Witness Book No. 1, Pg. 53
Fnd 1/2" Pipe in road.
16" Elm N45°E 130' #8
U.S.G.S. Mon SW 60' #9
14" Elm N35°E 26.2' #10

July 2, 1980 New. Eng. & Sur. Co.
Found 3/4" Pipe
P.Pole N60°+W 99.52' #11
Conc. Mon. N45°W 45.82' #12
4" Maple S20°+E 43.40' #13

Terrill, Kistler & Anderson No Date
1/2" Pipe
16" Elm N45°E 130' #8
USGS Mon SW 60.0' #9
14" Elm N35°E 26.2' #10

10-3-1955 Ralph A Smith RLS #22439
Book 55 Pg. 48
Found Cedar Stake - Set 1/2" gas pipe
Driven in cedar stake

NCRC Sheet
1/2" pipe
16" Elm N45°E 130.0' #8
USGS Mon SW 60.0' #9
14" Elm N35°E 26.2' #10

April 5, 1990 Wm. Fries Jr, RLS #30389
Fnd. 1" Pipe
10" Elm AZ 36° (N36°E) 31.27' #14
10" Maple AZ 156° (S24°E) 43.40' #13
P.Pole AZ 299° (N61°W) 99.50' #11
Recorded in L.C.R.C. #974

SURVEY &
REMONUMENTATION

DEC 07 2000

SECTION