

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

94 JAN 21 PM 3 29

*Marlene Toogood*

VOL 001 PAGE 70

Register of Deeds Stamp & File Number

For corners in

Newaygo (County)	Located in:	Corner Code #
1. Public Land Survey	T <u>16N</u> R <u>11W</u>	A-5
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Norman L. Ochs, in a field survey on December 07, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

SW. Corner, Section 7, Barton Twp., Newaygo Co., Mich.

A. Description of original monument and accessories and/or subsequent restoration:

- G.L.O. 1939 L.M. Gibson U.S.F.S. found pile of stone
- 14" Hemlock N43°W 161ks. (10.56') #1 U.S.F.S. Post East 1 link (.66') #6
- 26" Hemlock S52 1/2°W 401ks. (36.96') #2
- Jan. 12, 1900 Book B Pg's 285&286 Donald R. Verba R.L.S. #13603
- Delos G. Anderson, Co. Surveyor found rock and iron 5-11-71
- 12" Pine tree N45°E 941ks. (62.04') #3

Lyle S. Shepherd R.L.S. #503 Found old stake and stone 30" Pine stump S 82 1/2°E Book 36 Page 94 1916 #5 Maple N 75°W 39 1/2' #5 59' #4

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

In 1900 Delos G. Anderson did a section break of said section. As well as Lyle S. Shepherd did in 1916. Shepherd found old stake and stone and did not recover any of the older witnesses. In 1971 Donald R. Verba found rock and iron. In 1973 Robert A. Griffin set a 5" x 36" Concrete Monument.


1973 Robert A. Griffin #13584 Set Conc. Monument  
29" Maple N75°W 39.62' #5  
4'x7' Post East 33.31' #7  
SW. Leg Tower N17°E 150.71' #8

Found Robert A. Griffin's Monument in Good Condition  
Condition of recorded witnesses is: #1 thru #4 Gone #5 Good Condition #6 Gone #7 Good Condition #8 Gone

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Accepted Robert A. Griffin's Concrete Monument as a substantial marker for the Section Corner and is accepted as a careful and faithful reestablishment of the original corner.

- 29" Maple (Dead) N75°W 39.62' spike in North side of tree #5
- 4'x7' Post East 33.30' nail in North side of post #7
- Cor, Fence post N50°W 41.05' spike in South side of post
- 6" Cherry S21°W 117.32' Spike in East side of tree
- 28" Maple n75°W 72.80' spike in South side of tree

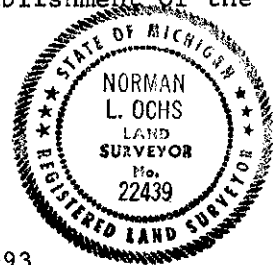

Signed by Norman L. Ochs Date December 27, 1993

Surveyor's Michigan License No. Norman L. Ochs R.L.S. #22439

Approved by Peer Review Group December 27, 1993  
Norman L. Ochs, County Representative

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 26, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983

SURVEY & REMONUMENTATION

JEG 07 2000

SECTION