

1994 NEWAYGO COUNTY REMONUMENTATION PROJECT

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

VOL 001 PAGE 145

For corners in

_____ <u>Newaygo</u> _____ (County)	Located In:	Corner Code -#
1. Public Land Survey	T <u>16N</u> R <u>12W</u>	<u>C-6</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

NEWAYGO COUNTY  
REGISTER OF DEEDS  
MARLENE TOOGOOD

'95 MAR 14 PM 3 59

*Marlene Toogood*  
Register of Deeds Stamp & File Number

I, Norman L. Ochs, in a field survey on April 4, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**  
W-1/4 Cor., Sec. 17, Home Twp., Newaygo County MI


A. Description of original monument and accessories and/or subsequent restoration:  
GLO Milton Nye 1856 Gerald J. Gray RLS #17741  
14" Y. Pine N40°E 12 lks (7.92') #1 7-20-73 Recorded in Series F No. 8389  
12" Y Pine S40°W 29 lks (19.14') #2 Measured 2794.39 ft. from the W-1/4 cor. to the NW cor.  
D. Anderson (County Surveyor) Measured 2634.27 ft. from the W-1/4 cor. to the SW cor. Sec. 17.  
July 9, 1901  
Found old Gov't Cor. Witness  
Old log Fence #3  
Measured 40 chains (2640 ft) from  
E-1/4 cor. to C-1/4 Cor., Sec. 18

-OVER-----

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
In April, 1994, I, Norman L. Ochs, found broken off U.S.F.S. 36" con. mon. w/brass cap gone. I measured 2795.17 ft. from the W-1/4 cor. to the NW cor. of Sec. 17 and measured 2634.40 ft. from the W-1/4 cor. to the SW cor. of Sec. 17. I replaced broken conc. mon with a 4" cast iron Harrison mon. in the exact location. Condition of recorded witnesses is: #1 thru #3 gone, #4 thru #7 good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
Accepted 4" Harrison cast iron monument as a substantial marker for the Section corner and is accepted as a careful and faithful reestablishment of the original corner.

10" B. Oak S50°W 59.23' Spk. on NW side of tree. #4  
16" W. Oak S37°E 33.51' Spk in NE side of tree. #5  
18" W. Oak N40°E 37.51' Spk in NW side of tree #6.  
4" Steel fence post N55°W 56.28'.  
1/2" rerod East 33.17' #7

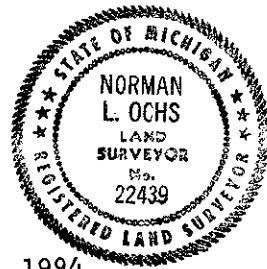

Signed by Norman L. Ochs  
Surveyor's Michigan License No. 22439

Date October 19, 1994

Approved by Peer Review Group on October 19,  
Norman L. Ochs County Representative N.L.O.

1994 FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983

SURVEY &  
REMONUMENTATION

JEG 07 2000

SECTION

A cont.

3-27-74 Paul Paquette RLS #16938  
Set 5" x 5" conc. mon.  
8" B. Oak S50°W 59.15' #4  
14" W. Oak S35°E 33.48' #5  
16" W. Oak N45°E 37.49' #6  
Measured 2795.96 ft. from the E-1/4  
cor. to the NE cor. of Sec. 18.  
Recorded LCRC #323

5-6-74 Robert A./Griffin RLS #13584  
Fnd. 5" sq. x 36' conc. mon #16938  
18" W. Oak N40°E 37.51' #6  
1/2" rerod East 33.17' #7  
16" W. Oak S43°E 33.51' #5  
10" R. Oak S5°W 59.25' #4

Measured 2796.94 ft. from the E-1/4  
cor. to the NE cor.  
Measured 2623.04 ft. from the E-1/4  
cor. to the C-1/4 cor.  
Measured 2634.75 ft. from the E-1/4 cor.  
to the SE cor. all in Sec. 18.

2/8/82 Newaygo Eng. & Survey Co.

Fnd. conc. mon.  
18" W. Oak N40°E 37.51' #6  
16" W. Oak S43°E 33.51' #5  
10" R. Oak S50°W 59.25' #4

Measured 2795.60 ft. from the W-1/4  
cor. to the NW cor.  
Measured 2634.27 ft. from the W-1/4  
cor. to the SW cor. all in Sec. 17.

June & July, 1983 Alton W. Howard RLS #2382.  
Recorded in Series O No. 749.

Measured 2635.00 ft. from the E-1/4 cor. to the SE cor.  
Measured 2623.30 ft. from the E-1/4 cor. to the C-1/4 cor. all in Sec. 18  
16" W. Oak S37°E 33.47' Spk. on NE side.  
B. Oak S50°W 59.23' Spk. on NW side.  
18" W. Oak N40°E 37.49' Spk on W side.  
4" Fe Post N55°W steel 56.24'

SURVEY &  
REMONUMENTATION

DEC 07 2000

SECTION