

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

VOL 001 PAGE 149

For corners in  
Newaygo  
(County)

	Located In:	Corner Code #
1. Public Land Survey	T <u>16N</u> R <u>13W</u>	<u>K-3</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

NEWAYGO COUNTY  
REGISTER OF DEEDS  
MARLENE TOOGOOD

'95 MAR 14 PM 4 00

*Marlene Toogood*

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	13	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Norman L. Ochs, in a field survey on April 19, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

SE Corner, Section 2, Lilley Twp., Newaygo County MI

A. Description of original monument and accessories and/or subsequent restoration:

GLO Mullett & Brookfield 1857  
10" P.Pine N75-3/4°E 22 lks (14.52') #1  
12" W. Oak S71°W 59-1/2 lks (39.27') #2  
16" W. Pine S45°E 88 lks (58.08') #3

Lyle S. Shepherd RLS #503  
Witness Book April 1931  
SW Cor. School 80.4' #4  
SE Cor. School 63.7' #5  
NE Cor. School 86.4' #6  
Measured 2583.96 ft. from NE cor.  
Sec. 11 to N-1/4 cor.

Wm. M. Jacques (County Surveyor)  
Book 8, Pg. 56 3/23/1906  
Measured 39.11 Ch. (2581.26 ft) from  
SE cor. to S-1/4 cor. Section 2

-OVER-

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

April 19, 1994, Found USFS conc. mon w/brass cap set by R.A.G. in good condition.  
Condition of witnesses #1 gone, #2 gone, #3 gone, #4 gone #5 gone, #6 gone, #7 found stump, #8 found in good condition, added spike ON West tree at 56.40' S15°W.


Fd. in good condition. Added spk. on NE side at 46.45' S35°E.  
Cond. Plat mon. 33.04' S. Good condition. #10

Fd. P.Pole Good condition Double Head Nail on NE side 48.89' N35°W. #13  
Fd. P.Pole Good condition Double Head Nail on E side 39.45' S8°W. #12  
Fd. U.S.F. Post in good condition 32.40' Due South. #11  
Fd. in Good condition added spike on NE side 46.45' S35°E. #9

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Accepted the U.S.F.S. conc. mon. as a careful and faithful reestablishment of the position of the original corner.

14" B. Oak S15°W 56.40' (spk. W) #8.  
12" B. Oak S35°E 46.45' (Spk. SW) #9.  
P.Pole N35°W 48.89' (Dbl head nail w/shiner) #13.  
P.Pole S08°W 39.45' (Dbl head nail w/shiner) #12.

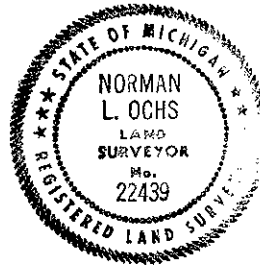

Signed by Norman L. Ochs  
Norman L. Ochs  
Surveyor's Michigan License No. 22439

Date October 19, 1994

Approved by Peer Review Group on October 19, 1994.  
Norman L. Ochs, County Representative

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983

SURVEY &  
REMONUMENTATION  
DEC 07 2000  
SECTION

NCRC Sheet

2" Sq. Pine Stake  
NE Cor. School NNW 86.4' #6  
10" B. Oak N55°E 49.4' #7  
10" B. Oak S35°E 46.3' #9  
12" W. Oak S15°W 55.9' #8  
Measured 2601.00 ft. from SE  
cor. to E-1/4 cor., Section 2.

Jan. 1951 George Blass #5489  
1" Iron Rod LCRC #410  
10" B. Oak N55°E 49.35' #7  
12" W. Oak S15°W 55.90' #8  
10" B. Oak S35°E 46.30' #9  
Measured 2584.87 ft. from SE  
cor. to S-1/4 cor., Sec. 2 and  
measured 2606.97 ft. from SE  
cor. to E-1/4 cor., Sec. 2.

1952 and 1957 R. A. Smith #3421  
"White's Resort" Recorded in Liber 6, Pg 21.

Measured 2583.96 ft. from NE cor. to N-1/4  
cor. Sec. 11 and measured 2601.00 ft.  
from SE cor. Sec. 2 to the E-1/4 corner.

R. A. Griffin #13584  
Nov. 1, 1976 Found 1" iron rod. Replaced  
w/5" sq. by 36" conc. mon. in the exact  
location.  
4" x 36" cond. mon. Fd. S 33.07' (Center)  
#10.  
4" x 7' Pine Post South 32.46' #11.  
P.Pole S8°W 39.49' #12.  
P.Pole N35°W 48.89' #13.

SURVEY &  
REMONUMENTATION

DEC 11 / 2000

SECTION