

MAR 11 1999

LIBER 19350PC870

1 JA -5 99 001670

SECTION

LAND CORNER RECORDATION CERTIFICATE § 7.00 MISCELLANEOUS RECORDING
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Oakland (County)	Located in: Lyon Township	Corner Code #
1. Public Land Survey	T <u>1N</u> R <u>7E</u>	<u>A-4</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

\$ 2.00 REMONUMENTATION
 3 JAN 99 8:24 A.M. RECEIPT PAID
 PAID RECORDED - OAKLAND COUNTY
 G. WILLIAM CADDELL
 CLERK/REGISTER OF DEEDS
 Compliance with
 ACT 345, P.A. 1990

APPROVED ON: 11-24-98 JS
 OAKLAND COUNTY REMONUMENTATION
 PEER GROUP COMMITTEE

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	6	5	4	3	2	1						
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Bruce Antcliff, in a field survey on May 19 19 98, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

A-4 This corner was not originally set by the G.L.O.

1989	Donnell	Survey	N/A
1997	B. Boss	L.C.R.C. L.S.C. #825m M-4, T1N, R6E	Iron Pipe
N/A	N/A	O.C. Tax Maps	N/A

Records indicate this corner is not common with M-4, T1N, R6E.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-4 Found no information on record pertaining to this corner. Found an iron pipe on the C/L of Dixboro Road (gravel) running North and South and 45' ± South of a fence line running East. The found iron pipe is 222.79' South of the Livingston County monument at the West 1/4 corner of Section 12, T1N, R6E as set in L.C.R.C. L.S.C. #825m (Livingston County Records). The found iron pipe is 0.1' North of the midpoint between A-3 and A-5 and 2' East of the line between M-4 and M-5, T1N, R6E. Accepted as corner.

Measure North 2640.1' to A-3
 Measure South 2640.3' to A-5

Measure North 222.79' to M-4, T1N, R6E (L.C.R.C. L.S.C. #825m = 223.44')

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-4 Replaced iron pipe with a 5/8" x 24" rebar with brass cap stamped "Oakland County Remonumentation P.S. #25826."


- PK Nail & Oakland Co. Remonumentation Tag in N Side 36" Oak S 62° W 26.71'
- PK Nail & Oakland Co. Remonumentation Tag in N Side P. Pole N 78° W 60.80'
- PK Nail & Oakland Co. Remonumentation Tag in E Side 8" Oak N 50° W 51.86'
- PK Nail & Oakland Co. Remonumentation Tag in NW Side 40" Willow N 32° E 70.79'
- L.C. Brass Cap North 222.79'

The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

Signed by Bruce Antcliff
 EARTH TECH

Date 12-24-98

Surveyor's Michigan License No. 25826

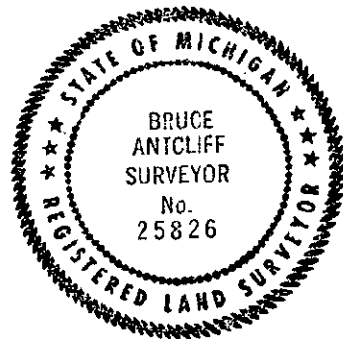

700 FILE
200