

LIBER 19296PG630

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970


SECTION
For corners in
Oakland
(County)

Located in: Lyon Township
Corner Code #

- 1. Public Land Survey T 1N R 7E L-5
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R
4. Lot No. , Recorded Plat
5. Private Claims

\$ 9.00 MISCELLANEOUS RECORDING
\$ 2.00 REMONUMENTATION
17 DEC 98 3:41 P.M. RECEIPT# 518
PAID RECORDED - OAKLAND COUNTY
G. WILLIAM CARROLL
CLERK/REGISTER OF DEEDS
Compliance with
ACT 345, P.A. 1990
APPROVED ON: 11-24-98 J
OAKLAND COUNTY REMONUMENTATION
PEER GROUP COMMITTEE
Register of Deeds Stamp & File Number

I, Bruce Antcliff, in a field survey on June 3, 1998, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

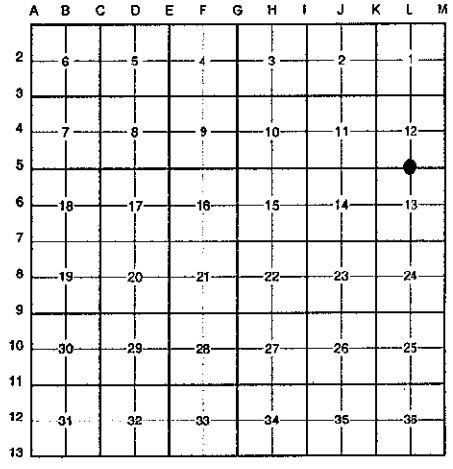

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
L-5 1816 Holmes G.L.O. Set Post
1963 N/A O.C.R.C. Sec. Cor. Ties N/A
1974 Kostecke Boundary Survey 1/4" Iron
(Continued on Back)


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
L-5 Found a 1/2" rerod on the C/L intersection of 12 Mile (gravel) running East and West and John's Road (gravel) running South on line of a fence line running North. Checks the following witnesses:
O.C.R.C. Section Corner Ties (1966) Boundary Survey (1974) Cert. Survey L. 11156 P. 250 (1989)
SW 72.95' Utility Pole (m. 74.64') NE 62.75' to 24" Oak (m. 61.77') S 55° E 57.31' N & T #12584 N/Side P.P. (m. 57.39')
NE 60.85' 26" Oak Tree (m. 60.09') SE 57.35' to Tel. Pole (m. 57.39') N 70° E 61.82' N & T #12584 S/Side P.P. (m. 61.77')
S 70° W 74.68' N & T #12584 N/Side P.P. (m. 74.64')

Measure East 2666.1' to M-5 (G.L.O. = 2651.55') (Finney survey (1979) = 2666.64')
Measure West 2669.3' to K-5 (G.L.O. = 2665.74') (Boss Survey (1989) = 2668.96')

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
L-5 Replaced 1/2" rerod with a 5/8" x 24" rebar with brass cap stamped "Oakland County Remonumentation P.S. #25826."
PK Nail & Oakland Co. Remonumentation Tag in N Side P. Pole S 55° E 57.39'
PK Nail & Oakland Co. Remonumentation Tag in S Side 30" Oak N 70° E 61.77'
PK Nail & Oakland Co. Remonumentation Tag in N Side P. Pole S 70° W 74.64'
PK Nail & Oakland Co. Remonumentation Tag in 26" Oak Northeast 60.09'
PK Nail & Oakland Co. Remonumentation Tag in W Side 12" Elm S 72° E 57.74'

The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

Signed by Bruce Antcliff Date 12-10-98
EARTH TECH

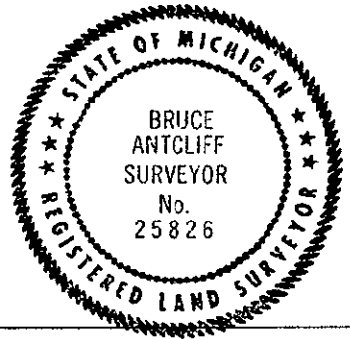

Surveyor's Michigan License No. 25826

1939

SECTION

192960531

A. Description of original monument and accessories and/or subsequent restoration:

L-5	1975	Finney	Survey	Rerod
	1978	Finney	Cert. Survey L. 7242 P. 838	Rerod
	1979	Finney	Cert. Survey L. 7650 P. 223	N/A
	1983	Kostecke	Drawing	N/A
	1987	Kostecke	Survey	N/A
	1989	Boss	Cert. Survey L. 11156 P. 249-250	3/4" Iron Rod
	1991	Kostecke	Survey	N/A
	N/A	N/A	O.C. Tax Maps	N/A