

LIBER 16850PG434

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Table with columns: Oakland (county), Located In, Corner Code #. Rows include Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Sec.

\$ 7.00 MISCELLANEOUS RECORDING
\$ 2.00 REMONUMENTATION
19 DEC 96 11:04 A.M. RECEIPT# 178
PAID RECORDED - OAKLAND COUNTY
LYNN D. ALLEN, CLERK/REGISTER OF DEEDS
ACT 345, P.A. 1999

APPROVED ON: 11-6-96
OAKLAND COUNTY REMONUMENTATION
FEE GROUP COMMITTEE

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, Joseph C. Kapelczak, in a field survey on September 7, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Grid table with columns A-L and rows 2-13. Contains numbers 1-36 in a grid pattern.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
Post set in 1816 G.L.O. Survey. No witnesses.

L.C.R.C. Higgins 1988 L.11041 P.605
3/4" Rerod
S.E. 42.71' upper nail & shiner northeast face power pole
S.W. 74.71' "X" cut in top Detroit Metro water pipeline marker
N.W. 58.53' "X" cut in south rim sanitary manhole
East 125.40' 3/4" rerod S 1/4 Sec. 36 T.2N, R.8E

L.C.R.C. Milletics 1992 L.12921 P.782
Fd. Monument box w/rerod
N.E. 46.84' PK nail west side 22" Maple
S.W. 44.70' PK nail in fence post 4th from east end
S.E. 42.47' previous witness in power pole G.W. #42458
N.W. 38.79' PK nail east side 9" Elm

L.C.R. C. Schultz 1989, L.10966 P.425
Fd. 5/8" Iron in monument box
S 44.16' nail w/M.D.O.T. tag in 10" Hickory
S 35 E 42.66' nail w/M.D.O.T. tag in telephone pole
N 25 W 39.14' nail w/M.D.O.T. tag in 5" Elm
N 50 E 47.22' nail w/M.D.O.T. tag in 7" Elm
W 2531.94' Iron, W 2753.90' Iron

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Recovered 5/8" rerod in monument box 1.0' (+/-) south centerline 14 Mile Road 22' Bit. Rd.
Recovered witnesses.

S 46 W 44.65' PK nail northwest side fence post
S 01 W 44.17' nail w/M.D.O.T. tag east side 8" Hickory
S 04 W 59.93' 1/2" rerod cap J.L.B. #25829 northwest corner Parcel #22-01-200-001
S 36 E 42.73' nail southwest side MBT pole
S 37 E 42.42' nail w/tag G.W. 42458 north side MBT pole
S 37 E 42.65' nail w/tag M.D.O.T. northeast side MBT pole
N 22 W 38.76' nail northeast side 8" Elm
N 50 E 46.78' nail west side 8" Elm
S 86 E 125.32' 5/8" Iron in monument box #17632
S 14 W 33.77' fence corner

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set remonumentation brass cap.
S 05 W 66.24' set nail w/remon tag east side 12" Hickory
S 29 E 75.78' set nail w/remon tag northeast side 24" Maple
S 04 W 108.69' set nail w/remon tag east side power pole
N 30 W 58.63' chisled "+" north-rim sanitary manhole


Signed by Joseph C. Kapelczak
Surveyor's Michigan License No. 24598

Date 11/6/96

SURVEY &
REMONUMENTATION

MAY 22 1997

COMMISSION

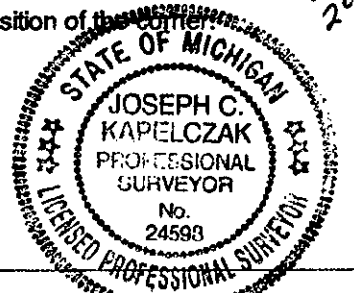

700
200