

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Oakland
(County)

Located In: Farmington Twp. Corner Code #

1. Public Land Survey

T 1-N R 9-E G-12

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

SURVEY &
REMONUMENTATION

MAR 21 2000

4. Lot No. _____, Recorded Plat _____ SECTION _____

5. Private Claims _____

I, John N. Redash, in a field survey on March 4, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


A. Description of original monument and accessories and/or subsequent restoration:

1817	Set post	S. Carpenter	n/a	G.L.O. Notes
1978	Found iron in monument box	J. Kapelczak	#24598	Survey L7147, P139
1978	Not described	T. Gilmore	#16930	Survey L7174, P452
1979	Found iron in monument box	E. Anderson	#11495	L.C.R.C. L7716, P210

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A 1/2" iron rod in monument box currently marks this corner. Current measurements match two ties each from Survey L7174, P452 and L.C.R.C. L7716, P210. Field measurements were made between the following corners:

G-11 to G-12	G-12 to G-13
2645.06 meas.	2649.70 meas.
2640.00 Rec. G.L.O.	2640.00 Rec. G.L.O.
2644.91 Rec. Survey L7147, P139	2648.14 Rec. Tax maps
2644.73 Rec. Survey L7174, P452	2648.66 Rec. Plats L104, P28
2646.74 Rec. Plats L26, P2	

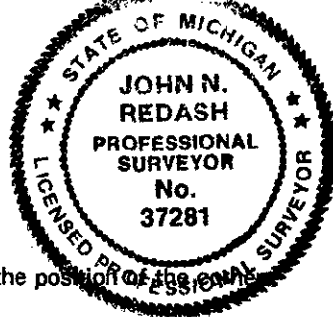

700 FILE
200 ✓

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I placed a 2" diameter brass cap stamped "Oakland County Remonumentation PS 37281" on the existing 1/2" iron in monument box. Witnesses are as follows:

N. 80° W.,	39.52'	P.K. nail and remon. washer S.E. face U-pole
S. 45° W.,	67.24'	P.K. nail and remon. washer N.W. face U-pole
S. 30° E.,	66.95'	Cut cross N.W. bolt light pole base
Due East,	51.15'	P.K. Nail and remon. washer S. face U-pole

The selected location is accepted by me and generally accepted by Professional Surveyors as the best available evidence of the position of the original corner.

Signed by John N. Redash

Date March 24, 1997

Surveyor's Michigan License No. 37281

JA-2 98 0000242