

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Oakland (County)

Located In: Farmington Twp. Corner Code #

- 1. Public Land Survey T 1-N R 9-E H-11
2. Property Controlling in Section S T R SURVEY & REMONUMENTATION
3. Miscellaneous Property in Sec. S T R MAR 21 2000

4. Lot No. , Recorded Plat SECTION
5. Private Claims

I, John N. Redash, in a field survey on March 6, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Table with 4 columns: Year, Description, Name, License No.
1817 Set post S. Carpenter N/A G.L.O. notes
1941 Iron found J. Kiraly #2974 Unrecorded Survey
1975 Found iron D. Hooth #7966 L.C.R.C. L6479, P162
1979 Found iron E. Anderson #11495 L.C.R.C. L7716, P210
1988 Ref. L.C.R.C. L7716, P210 K. Wilkerson \$21584 Survey L10650, P319

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A 1/2" iron found in the centerline of 9 Mile Road and Powers Road currently occupies this corner. Current measurements match 3 ties each from L.C.R.C. L6479, P162 and L7716, P210. Field measurements were made between the following corners:

Table with 2 columns: Corner Pair, Measurement
G-11 to H-11 2626.98 Meas.
H-11 to I-11 2631.54 meas.
2619.38 Rec. G.L.O.
2627.56 Rec. MDOT ROW Plan #63-R-1, Sheet #17


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the 1/2" iron with a 5/8" x 24" iron rod with 2" dia. brass cap stamped "Oakland County Remonumentation P#37281" monument box. Witnesses are as follows:

Table with 3 columns: Bearing, Distance, Description
N. 50° E., 27.78' P.K. nail and remon. washer S.E. face U-pole
N. 30° W., 55.44' P.K. nail and remon. washer W. Root 30" Maple
S. 55° E., 35.60' P.K. nail and remon. washer N.E. face 18" Ash
Due South 25.52' P.K. nail and remon. washer W. face 30" Walnut

The selected location is accepted by me and generally accepted by Professional Surveyors as the best available evidence of the position of the original corner.

Signed by [Signature] Date March 24, 1997
Surveyor's Michigan License No. 37281

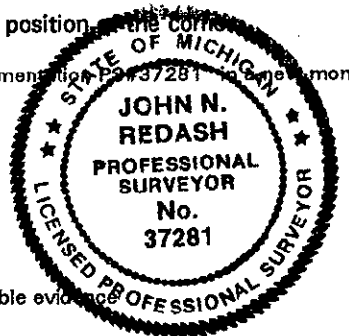

Compliance with ACT 345, P.A. 1990
APPROVED ON: 5-17-97
OAKLAND COUNTY REMONUMENTATION PEER GROUP COMMITTEE
\$ 7.00 SURVEY RECORDING Number 5
\$ 2.00 REMONUMENTATION
2 JAN 98 9:06 A.M. RECEIPT# 12A
PAID RECORDED - OAKLAND COUNTY
LYNN B. ALLEN, CLERK/REGISTER OF DEEDS

Grid table with 12 rows and 6 columns, containing numbers 1-36 and a dot in cell 11-34.