

SURVEY & REMONUMENTATION

MAR 04 1998

LIBER **17277PG716**
LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

Compliance with
 ACT 345, P.A. 1990

For corners of **SECTION**

Oakland
 (County)


Located in: Farmington Township Corner Code #

- | | | | |
|------------------------------------|-------------|-------------|------------|
| 1. Public Land Survey | T <u>1N</u> | R <u>9E</u> | <u>M-6</u> |
| | T _____ | R _____ | _____ |
| | T _____ | R _____ | _____ |
| | T _____ | R _____ | _____ |
| 2. Property Controlling in Section | S _____ | T _____ | R _____ |
| | S _____ | T _____ | R _____ |
| 3. Miscellaneous Property in Sec. | S _____ | T _____ | R _____ |
| | S _____ | T _____ | R _____ |

APPROVED ON: 4-16-97 MS
 OAKLAND COUNTY REMONUMENTATION
 PEER GROUP COMMITTEE

\$ 7.00 MISCELLANEOUS RECORDING
\$ 2.00 REMONUMENTATION
 9 JUN 97 12:24 P.M. RECEIPT# 94A
 PAID RECORDED - OAKLAND COUNTY
 LYNN D. ALLEN, CLERK/REGISTER OF DEEDS
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

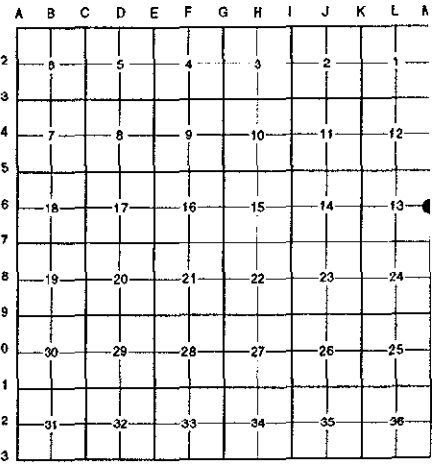

I, Randy Kolehouse, in a field survey on April 9 19 97, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-6	1817	Wampler	G.L.O. Notes	Set Post
	1954	McAlpine	Pebblebrook Estates L. 72 P. 39	N/A
	1954	N/A	Duke's Forestbrook Hills Sub. L. 71 P. 2-3	N/A
	1987	Gorman	L.C.R.C. L. 10295 P. 550	5/8" Rerod in Cast Iron Box
	N/A	N/A	O.C. Tax Maps	N/A

Records indicate this corner is common with A-6, T1N, R10E.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-6 Found a 1/2" rebar with cap #17622 in a monument box at the C/L of Inkster Road (bit.) running North and South and 12' ± South of the C/L of Pebblebrook Road (gavel) running East per L.C.R.C. L. 10295 P. 550. Checks closely distances as shown in recorded plats.

L.C.R.C. L. 10295 P. 550 (1987)
 N 40° E 62.37' Chiseled "+" on MH Rim of Water Gate (m. 62.36')
 S 80° E 73.62' Top of Fire Hydrant (m. 73.49')

Measure North 2641.92' to M-5 (G.L.O. = 2640.0') (Pebblebrook Est. & Duke's Forestbrook Sub. = 2641.97')
 Measure South 2648.76' to M-7 (G.L.O. = 2640.0')

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-6 Replaced 1/2" rebar with a 5/8" x 24" rebar with brass cap stamped "Oakland County Remonumentation P.S. #25854" in an existing monument box.

PK Nail & Tag Stamped "Oakland Co. Remonumentation P.S. #25854" in SW Side Util. Pole N 26° W 77.78'
 PK Nail & Tag Stamped "Oakland Co. Remonumentation P.S. #25854" in NW Side 24" Poplar N 63° E 64.73'
 PK Nail & Tag Stamped "Oakland Co. Remonumentation P.S. #25854" in S Side Util. Pole N 83° W 40.49'
 "+" SW Rim M.H. N 35° E 62.36'
 C/L Top Nut Hydrant S 85° E 73.49'
 Concrete Monument N 85° W 59.98'

The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

Signed by Randy Kolehouse Date 5/28/97
 EARTH TECH

Surveyor's Michigan License No. 25854

