

**SURVEY &  
REMONUMENTATION**

MAY - 1 1995

LIBER **14833** Pg **144**

**94 193388**  
Compliance with  
ACT 345, P.A. 1999

**LAND CORNER RECORDATION CERTIFICATE**  
**COMMISSION Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in  
Oakland


APPROVED ON: 1-19-94  
OAKLAND COUNTY REMONUMENTATION  
PEER GROUP COMMITTEE

(County)	Located In:		Corner Code #
	5N	11E	
1. Public Land Survey	T	R	D-5
	T	R	
	T	R	
	T	R	
2. Property Controlling in Section	S	T	R
	S	T	R
3. Miscellaneous Property in Sec.	S	T	R
	S	T	R

OK - T. SMITH  
\$ 7.00 MISCELLANEOUS RECORDING  
\$ 2.00 REMONUMENTATION  
15 JUL 94 7:32 A.M. RECEIPT# 1A  
PAID RECORDED - OAKLAND COUNTY  
LYNN D. ALLEN, CLERK/REGISTER OF DEEDS

**Register of Deeds Stamp & File Number**

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

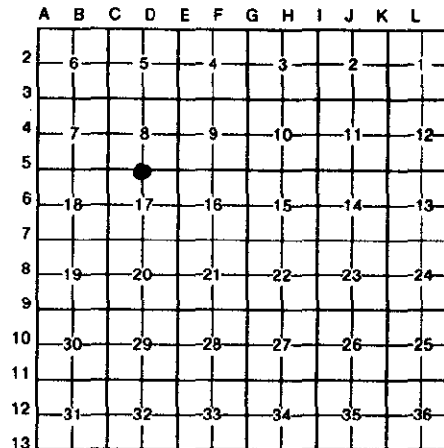

**Bruce Antcliff** November 11 93

I, \_\_\_\_\_, in a field survey on \_\_\_\_\_, 19\_\_\_\_, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

<b>D-5 GLO Post</b>	Liber 6113 P. 121 (1973) 1/2" iron pipe N 10° W - 20.80' 20" Maple N 50° E - 49.25' 18" Cherry S 10° W - 27.77' 12" Oak	L.C.R.C. L.10709 P. 795 (1988) 1/2" iron pipe N 45° W - 34.65' to P.K/W NE Side 11" Ash S 05° W - 27.44' to P.K/W E Side 19" Oak N 75° W - 71.43' to P.K/W NE Side 11" Ash	L.C.R.C. L.8163 P. 794 (1982) 3/4" pinch pipe N 15° W - 34.7' 8" Ash N 60° W - 35.63' 6" Ash S 10° W - 27.48' 14" Oak North 28.65' Fence Corner
---------------------	---	--	--

Survey: H. Kennedy (2/12/87) & (5/22/87) & (9/1/88)  
Same as L.C.R.C. L. 10709, P. 795

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

**D-5 Found 3/4" pinched iron pipe in centerline of gravel road running E & W (Noble Road). Checks the following witnesses:**

L.C.R.C. L.6113 P. 121 N 10° W - 20.80' 20" Maple S 10° W - 27.77' 12" Oak	L.C.R.C. L.10709 P. 795 S 05° W - 27.44' P.K. East Side 19" Oak	L.C.R.C. L.8163 P.794 S 10° W - 27.48' 14" Oak
--	--	---

Survey: H. Kennedy (2/12/87) & (5/22/87) & (9/1/88)  
Same as L. 10709, P. 795

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

**D-5** The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

Set 5/8" rebar with standard Oakland County cap.

- P.K. Nail and Brass Tag in E Face 24" Maple N 10° W - 21.32'
- P.K. Nail and Brass Tag in SW Face 12" Ash N 45° W - 33.28'
- P.K. Nail and Brass Tag in W Face 26" Oak S 10° W - 26.98'
- P.K. Nail and Brass Tag in SW Face 14" Ash S 48° E - 43.90'



Signed by Bruce Antcliff  
Surveyor's Michigan License No. 25826

Date 7-11-94