

SURVEY & REMONUMENTATION

MAY - 1 1995

LIBER **14833** PG **130**

94 193374
OK - T. SMITH

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Oakland

	Located in:		Corner Code #
	5N	11E	
1. Public Land Survey	T _____	R _____	G-7
	T _____	R _____	
	T _____	R _____	
	T _____	R _____	
2. Property Controlling in Section	S _____	T _____	R _____
	S _____	T _____	R _____
3. Miscellaneous Property in Sec.	S _____	T _____	R _____
	S _____	T _____	R _____

\$ 7.00 MISCELLANEOUS RECORDING
\$ 2.00 REMONUMENTATION
15 JUL 94 7:30 A.M. RECEIPT# 1A
PAID RECORDED - OAKLAND COUNTY
LYNN D. ALLEN, CLERK/REGISTER OF DEEDS
Compliance with
ACT 345, P.A. 1990

APPROVED ON: 2-2-94
OAKLAND COUNTY REMONUMENTATION
PEER GROUP COMMITTEE
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Bruce Antcliff

November 9

93

I, _____, in a field survey on _____, 19 _____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-7 GLO	L.C.R.C. L.6034, P.632 (1973)	L.C.R.C. L.8096, P.220 (1981)
Post	1 1/2" pipe & plowshare	1/2" Iron Rod
	PK nail in North side of 10" maple - NW - 40.26 feet	N75°E - 50.57 ft - 15" Elm
	PK nail in East side of 6" maple - NW - 17.87 feet	N10°W - 17.96ft - 9" Elm
	PK nail in SW side of 24" maple - SE 68.66 feet	N45°W - 33.79 ft - 11" Cherry

L.C.R.C. L.7433, P.132. (1979)
3/4" Iron Bar
PK nail in 12" Maple NW - 40.26'
PK nail in 10" Maple NNW 17.87'
PK nail in 10" Maple - NE - 34.22'

Handwritten signature/initials

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-7 Found 1" Pipe at center line Army Road. Measure West 2,849.02' to S 1/4 Corner Section 16.
Checks the following witnesses:

L.C.R.C. L. 6034, P. 632
6" Maple NW 17.87'
10" Maple NW 40.26'

L.C.R.C. L.8096, P.220 (1981)
11" Cherry N45°W 33.79'
9" Elm N 10° W 17.96'


L.C.R.C. L.7433, P.132. (1979)
10" Maple NE 34.22'
10" Maple NNW 17.87'
12" Maple NW 40.26'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-7 The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

Set 5/8" rebar with standard Oakland County cap.

P.K. Nail and Brass Tag in NW face 32" Pine - S 40° W - 52.70'
P.K. Nail and Brass Tag in SW face 10" Cherry - N 50° W - 33.30'
P.K. Nail and Brass Tag in W face 44" Oak N 30° E - 29.87'
P.K. Nail and Brass Tag in S. face 8" Maple N 70° E - 34.38'

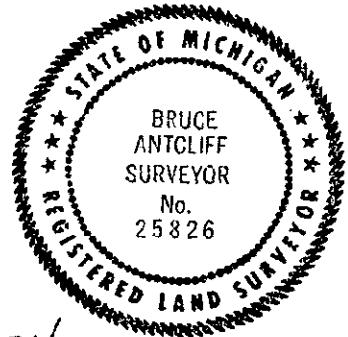

Signed by Bruce Antcliff Date 7-11-94
Surveyor's Michigan License No. 25826