

SURVEY & REMONUMENTATION

APR 24 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
 COUNTY OF OCEANA
 RECEIVED FOR RECORD
100581
 95 JAN -4 P3:24

For corners in

Oceana

(County)

Located In:

Corner Code #

- | | | | |
|---------------------------------------|---------------|---------------|------------|
| 1. Public Land Survey | T <u>13</u> N | R <u>17</u> W | <u>J-5</u> |
| | T _____ | R _____ | _____ |
| | T _____ | R _____ | _____ |
| | T _____ | R _____ | _____ |
| 2. Property Controlling in Section | S _____ | T _____ | R _____ |
| | S _____ | T _____ | R _____ |
| 3. Miscellaneous Property in Sec. | S _____ | T _____ | R _____ |
| | S _____ | T _____ | R _____ |
| 4. Lot No. _____, Recorded Plat _____ | | | |
| 5. Private Claims _____ | | | |

J. Randolph Hepworth
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, J. Randolph Hepworth, in a field survey on December 3, 1994,

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

| A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|----|----|----|----|----|----|---|---|---|---|---|---|
| 2 | 6 | 5 | 4 | 3 | 2 | 1 | | | | | | |
| 3 | | | | | | | | | | | | |
| 4 | 7 | 8 | 9 | 10 | 11 | 12 | | | | | | |
| 5 | | | | | | | | | | | | |
| 6 | 18 | 17 | 16 | 15 | 14 | 13 | | | | | | |
| 7 | | | | | | | | | | | | |
| 8 | 19 | 20 | 21 | 22 | 23 | 24 | | | | | | |
| 9 | | | | | | | | | | | | |
| 10 | 30 | 29 | 28 | 27 | 26 | 25 | | | | | | |
| 11 | | | | | | | | | | | | |
| 12 | 31 | 32 | 33 | 34 | 35 | 36 | | | | | | |
| 13 | | | | | | | | | | | | |

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
J-5 Corner Common To Sections 11 and 14 T13N, R17W Grant Township

- GLO SET POST 10" Cedar N 28°E 7lks 14"B. Ash S42°W 9lks
- Book B, Pg 2; F. Wetmore, 1899; old corner set by Hyde
- Book A, Pg 292; H. Grant, 1891; "Stone previously set by Hyde."
- OCRC WITNESS: Iron 8" Maple N55°W 60.9' Corner Fence post S 34.7'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner

I found a 1/2"x4" Bolt about 4" below the asphalt surface in the centerline of an asphalt road to east, centerline of a gravel road to west, and 6' west of the centerline of a new asphalt road to the north. No ancient occupation is visible to the south, however, there is a short row of small pine trees to the south 18 feet East.

Upon removal of the bolt, I could find no further evidence of any iron stakes in the vicinity. I excavated below the bolt to a depth of 3 feet, nothing found. The OCRC witness to a 8" Maple is standing - 30" Maple- and measures good.

Distance to K-5 measures 2664.01'; Grant distance is 2657.8'; and Wetmore distance is 2661.1'.
 Distance to I-5 measures 2651.30'; Grant distance is 2650.6'.

No evidence is known to me that would lead me to believe that the corner should be at another position. The 1/2" bolt is ACCEPTED AS A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION OF THE ORIGINAL CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

J-5 Corner Common To Sections 11 and 14 T13N, R17W Grant Township

SET "COUNTY SURVEYOR" HARRISON 4"X20" CAST IRON MONUMENT in the place of the 1/2" Bolt in the surface of the asphalt.


| | | | | | |
|---------|---------|-------------------|--------|--------|-----|
| 60d spk | NE Face | 30" Maple | 304°az | 59.97 | EDM |
| 60d spk | NE Face | 20" Maple | 287°az | 110.16 | EDM |
| 60d spk | NW Face | Power Pole | 202°az | 37.22 | EDM |
| 60d spk | SW FACE | 4" Spruce | 166°az | 84.66 | EDM |
| 60d spk | SE Face | Corner Fence post | 53°az | 60.55 | EDM |

Oceana County Remonumentation
 Peer Group Reviewed & Approved

Date: 12-1-94

JRH

J. Randolph Hepworth
 Oceana County Surveyor

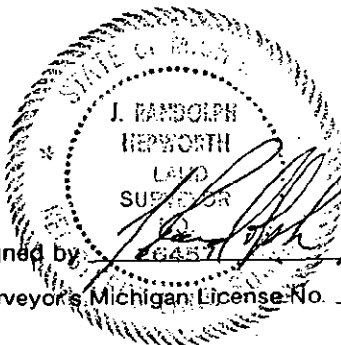

Signed by J. Randolph Hepworth Date December 28, 1994
 Surveyor's Michigan License No. 26457